Building Information - Cuyahoga Falls City (43836) - Elizabeth Price Elementary

Program Type	Classroom Facilities Assistance Program (CFAP) - Regular
Setting	Suburban
Assessment Name	Elizabeth_Price_ES_June_2009_Jan_2015_EEA_June_2018_Desktop_Update
Assessment Date (on-site; non-EEA)	2015-01-06
Kitchen Type	Full Kitchen
Cost Set:	2018
Building Name	Elizabeth Price Elementary
Building IRN	10215
Building Address	2610 Delmore Street
Building City	Cuyahoga Falls
Building Zipcode	44221
Building Phone	(330) 920-3635
Acreage	8.50
Current Grades:	K-5
Teaching Stations	23
Number of Floors	1
Student Capacity	293
Current Enrollment	386
Enrollment Date	2009-04-13

Enrollment Date is the date in which the current enrollment was taken.

Number of Classrooms	21
Historical Register	**NO**
Building's Principal	Mr. John Musat
Building Type	Elementary

Next Page

North elevation photo:

East elevation photo:

South elevation photo:

West elevation photo:

GENERAL DESCRIPTION

36,585 Total Existing Square Footage
1953,1963 Building Dates
K-5 Grades
386 Current Enrollment
23 Teaching Stations
8.50 Site Acreage

Elizabeth Price Elementary School, which is not on the National Register of Historic Buildings, and originally constructed in 1953, is a one story, 36,585 square foot brick school building located in a suburban residential setting. The existing facility features a conventionally partitioned design, and does not utilize modular buildings. The structure of the overall facility contains a brick veneer on a masonry bearing wall type exterior wall construction, with painted concrete masonry units, glazed block, plaster and metal framed partitions with gypsum board type wall construction in the interior. The base floor system of the overall facility consists of concrete slab-on-grade type construction. The floor system of the Stage Storage areas is wood deck on wood joist type construction. There are no intermediate floors in this single story structure. The roof structure of the overall facility, except over the Multipurpose space, is 2'' gypsum plank deck over on steel joist type construction. The roof structure of the Multipurpose space is 2'' gypsum plank deck over on steel beam type construction. The roofing system of the overall facility, except for over the Kindergarten Classroom, is an asphalt built-up roof with gravel wear coat roof that was installed in 1999. The roofing system over the Kindergarten Classroom is a granulated asphalt rolled roof that was installed in 1999. The ventilation system of the building is adequate to meet the needs of the users. The Classrooms are undersized in terms of the current standards established by the State of Ohio. Physical Education and Student Dining spaces consist of one Multipurpose space. The electrical system for the facility is inadequate. The facility is equipped with a non-compliant security system. The building has a non-compliant automatic and manual fire alarm system. The facility is not equipped with an automated fire suppression system. The building contains asbestos and other hazardous materials. The overall building is not compliant with ADA accessibility requirements. The school is located on an 8.5 acre site adjacent to residential properties. The property, playgrounds, and play areas are partially fenced for security. Access onto the site is unrestricted. Site circulation is fair. There is dedicated space for school buses to load and unload on the site, but is not separated from vehicular traffic. Parking for staff, visitors and community events is adequate.

No Significant Findings

Previous Page

Next Page

Building Construction Information - Cuyahoga Falls City (43836) - Elizabeth Price Elementary (10215)

Name	Year	Handicapped Access	Floors	Square Feet	Non OSDM Addition	Built Under ELPP
Original Construction	1953	no	1	32,418	no	no
Classroom Addition	1963	no	1	4,167	no	no

Previous Page

Next Page

Addition	Auditorium Fixed Seating	Corridors	Agricultural Education Lab	Primary Gymnasium	Media Center	Vocational Space	Student Dining	Kitchen	Natatorium	Indoor Tracks	Adult Education	Board Offices	Outside Agencies	Auxiliary Gymnasium
Original Construction (1953)		4625		4600	735			789						
Classroom Addition (1963)		635												
Total	0	5,260	0	4,600	735	0	0	789	0	0	0	0	0	0

Master Planning Considerations There is an area of approximately 20,000 SF to the east of the building where a small athletic field is located.

Previous Page

Next Page

Existing CT Programs for Assessment

Next Page

Previous Page

Program Type	Program Name	Related Space	Square Feet
No Records Found			

Legend:

Not in current design manual

In current design manual but missing from assessment

Building Summary - Elizabeth Price Elementary (10215)

District:	Cuyahoga Falls City	**County:**	Summit **Area:** Northeastern Ohio (8)
Name:	Elizabeth Price Elementary	**Contact:**	Mr. John Musat
Address:	2610 Delmore Street	**Phone:**	(330) 920-3635
	Cuyahoga Falls,OH 44221	**Date Prepared:**	2015-01-06 **By:** Bernie Merritt
Bldg. IRN:	10215	**Date Revised:**	2018-07-06 **By:** Jeff Tuckerman

Current Grades	K-5	Acreage:	8.50
Proposed Grades	N/A	Teaching Stations:	23
Current Enrollment	386	Classrooms:	21
Projected Enrollment	N/A		

Addition	Date	HA	Number of Floors	Current Square Feet
Original Construction	1953	no	1	32,418
Classroom Addition	1963	no	1	4,167
Total				**36,585**

*HA	=	Handicapped Access
*Rating	=1	Satisfactory
	=2	Needs Repair
	=3	Needs Replacement
*Const P/S	=	Present/Scheduled Construction

Suitability Appraisal Summary

Section	Points Possible	Points Earned	Percentage	Rating Category
Cover Sheet	—	—	—	—
1.0 The School Site	100	72	72%	Satisfactory
2.0 Structural and Mechanical Features	200	95	48%	Poor
3.0 Plant Maintainability	100	58	58%	Borderline
4.0 Building Safety and Security	200	113	57%	Borderline
5.0 Educational Adequacy	200	103	52%	Borderline
6.0 Environment for Education	200	127	64%	Borderline
LEED Observations	—	—	—	—
Commentary	—	—	—	—
Total	1000	568	57%	Borderline

FACILITY ASSESSMENT Cost Set: 2018			Rating	Dollar Assessment	C
A.	Heating System		3	$1,248,280.20	-
B.	Roofing		3	$698,952.00	-
C.	Ventilation / Air Conditioning		1	$0.00	-
D.	Electrical Systems		3	$593,774.55	-
E.	Plumbing and Fixtures		3	$391,295.00	-
F.	Windows		2	$48,688.00	-
G.	Structure: Foundation		2	$4,800.00	-
H.	Structure: Walls and Chimneys		2	$225,559.10	-
I.	Structure: Floors and Roofs		2	$23,220.00	-
J.	General Finishes		3	$1,105,871.10	-
K.	Interior Lighting		3	$182,925.00	-
L.	Security Systems		3	$164,267.25	-
M.	Emergency/Egress Lighting		3	$36,585.00	-
N.	Fire Alarm		3	$64,023.75	-
O.	Handicapped Access		2	$276,391.00	-
P.	Site Condition		2	$330,782.44	-
Q.	Sewage System		2	$39,750.00	-
R.	Water Supply		1	$0.00	-
S.	Exterior Doors		2	$4,750.00	-
T.	Hazardous Material		3	$128,208.50	-
U.	Life Safety		3	$151,692.00	-
V.	Loose Furnishings		3	$182,925.00	-
W.	Technology		3	$482,190.30	-
- X.	Construction Contingency / Non-Construction Cost		-	$1,559,857.60	-
Total				$7,944,787.79	

Enhanced Environmental Hazards Assessment Cost Estimates

C=Under Contract	
Renovation Cost Factor	103.60%
Cost to Renovate (Cost Factor applied)	$8,230,800.15

The Replacement Cost Per SF and the Renovate/Replace ratio are only provided when this summary is requested from a Master Plan.

Previous Page

Original Construction (1953) Summary

District:	Cuyahoga Falls City	**County:**	Summit **Area:** Northeastern Ohio (8)
Name:	Elizabeth Price Elementary	**Contact:**	Mr. John Musat
Address:	2610 Delmore Street	**Phone:**	(330) 920-3635
	Cuyahoga Falls,OH 44221	**Date Prepared:**	2015-01-06 **By:** Bernie Merritt
Bldg. IRN:	10215	**Date Revised:**	2018-07-06 **By:** Jeff Tuckerman

Current Grades	K-5	Acreage:	8.50
Proposed Grades	N/A	Teaching Stations:	23
Current Enrollment	386	Classrooms:	21
Projected Enrollment	N/A		

Addition	Date	HA	Number of Floors	Current Square Feet
Original Construction	**1953**	**no**	**1**	**32,418**
Classroom Addition	1963	no	1	4,167
Total				**36,585**

*HA	=	Handicapped Access
*Rating	=1	Satisfactory
	=2	Needs Repair
	=3	Needs Replacement
*Const P/S	=	Present/Scheduled Construction

Suitability Appraisal Summary

Section	Points Possible	Points Earned	Percentage	Rating Category
Cover Sheet	—	—	—	—
1.0 The School Site	100	72	72%	Satisfactory
2.0 Structural and Mechanical Features	200	95	48%	Poor
3.0 Plant Maintainability	100	58	58%	Borderline
4.0 Building Safety and Security	200	113	57%	Borderline
5.0 Educational Adequacy	200	103	52%	Borderline
6.0 Environment for Education	200	127	64%	Borderline
LEED Observations	—	—	—	—
Commentary	—	—	—	—
Total	1000	568	57%	Borderline

Enhanced Environmental Hazards Assessment Cost Estimates

C=Under Contract

Renovation Cost Factor	103.60%
Cost to Renovate (Cost Factor applied)	$7,383,367.33

The Replacement Cost Per SF and the Renovate/Replace ratio are only provided when this summary is requested from a Master Plan.

		FACILITY ASSESSMENT Cost Set: 2018	Rating	Dollar Assessment	C
	A.	Heating System	3	$1,106,102.16	-
	B.	Roofing	3	$620,071.20	-
	C.	Ventilation / Air Conditioning	1	$0.00	-
	D.	Electrical Systems	3	$526,144.14	-
	E.	Plumbing and Fixtures	3	$356,126.00	-
	F.	Windows	2	$43,728.00	-
	G.	Structure: Foundation	2	$4,800.00	-
	H.	Structure: Walls and Chimneys	2	$201,098.60	-
	I.	Structure: Floors and Roofs	2	$23,220.00	-
	J.	General Finishes	3	$1,021,626.80	-
	K.	Interior Lighting	3	$162,090.00	-
	L.	Security Systems	3	$152,391.30	-
	M.	Emergency/Egress Lighting	3	$32,418.00	-
	N.	Fire Alarm	3	$56,731.50	-
	O.	Handicapped Access	2	$256,391.00	-
	P.	Site Condition	2	$285,898.48	-
	Q.	Sewage System	2	$39,750.00	-
	R.	Water Supply	1	$0.00	-
	S.	Exterior Doors	2	$4,750.00	-
	T.	Hazardous Material	3	$106,491.80	-
	U.	Life Safety	3	$138,357.60	-
	V.	Loose Furnishings	3	$162,090.00	-
	W.	Technology	3	$427,269.24	-
-	X.	Construction Contingency / Non-Construction Cost	-	$1,399,256.63	-
Total				$7,126,802.45	

Classroom Addition (1963) Summary

District:	Cuyahoga Falls City	**County:**	Summit **Area:** Northeastern Ohio (8)
Name:	Elizabeth Price Elementary	**Contact:**	Mr. John Musat
Address:	2610 Delmore Street	**Phone:**	(330) 920-3635
	Cuyahoga Falls,OH 44221	**Date Prepared:**	2015-01-06 **By:** Bernie Merritt
Bldg. IRN:	10215	**Date Revised:**	2018-07-06 **By:** Jeff Tuckerman

Current Grades	K-5	Acreage:	8.50
Proposed Grades	N/A	Teaching Stations:	23
Current Enrollment	386	Classrooms:	21
Projected Enrollment	N/A		

Addition	Date	HA	Number of Floors	Current Square Feet
Original Construction	1953	no	1	32,418
Classroom Addition	**1963**	**no**	**1**	**4,167**
Total				**36,585**

*HA	=	Handicapped Access
*Rating	=1	Satisfactory
	=2	Needs Repair
	=3	Needs Replacement
*Const P/S	=	Present/Scheduled Construction

Suitability Appraisal Summary

Section	Points Possible	Points Earned	Percentage	Rating Category
Cover Sheet	—	—	—	—
1.0 The School Site	100	72	72%	Satisfactory
2.0 Structural and Mechanical Features	200	95	48%	Poor
3.0 Plant Maintainability	100	58	58%	Borderline
4.0 Building Safety and Security	200	113	57%	Borderline
5.0 Educational Adequacy	200	103	52%	Borderline
6.0 Environment for Education	200	127	64%	Borderline
LEED Observations	—	—	—	—
Commentary	—	—	—	—
Total	1000	568	57%	Borderline

FACILITY ASSESSMENT Cost Set: 2018			Rating	Dollar Assessment	C
A.	Heating System		3	$142,178.04	-
B.	Roofing		3	$78,880.80	-
C.	Ventilation / Air Conditioning		1	$0.00	-
D.	Electrical Systems		3	$67,630.41	-
E.	Plumbing and Fixtures		3	$35,169.00	-
F.	Windows		2	$4,960.00	-
G.	**Structure: Foundation**		**2**	**$0.00**	-
H.	Structure: Walls and Chimneys		2	$24,460.50	-
I.	**Structure: Floors and Roofs**		**2**	**$0.00**	-
J.	General Finishes		3	$84,244.30	-
K.	Interior Lighting		3	$20,835.00	-
L.	Security Systems		3	$11,875.95	-
M.	Emergency/Egress Lighting		3	$4,167.00	-
N.	Fire Alarm		3	$7,292.25	-
O.	Handicapped Access		2	$20,000.00	-
P.	Site Condition		2	$44,883.96	-
Q.	**Sewage System**		**2**	**$0.00**	-
R.	Water Supply		1	$0.00	-
S.	**Exterior Doors**		**2**	**$0.00**	-
T.	Hazardous Material		3	$21,716.70	-
U.	Life Safety		3	$13,334.40	-
V.	Loose Furnishings		3	$20,835.00	-
W.	Technology		3	$54,921.06	-
X.	Construction Contingency / Non-Construction Cost		-	$160,600.97	-
Total				$817,985.34	

Enhanced Environmental Hazards Assessment Cost Estimates

C=Under Contract	
Renovation Cost Factor	103.60%
Cost to Renovate (Cost Factor applied)	$847,432.82

The Replacement Cost Per SF and the Renovate/Replace ratio are only provided when this summary is requested from a Master Plan.

A. Heating System

Description: The existing system for the 1953 Original Construction is a natural gas fired heated water boiler type system, installed in 1953, and is in fair to poor condition. The system in the 1963 Addition is an extension of that found in the 1953 Original Construction. 2-pipe vs. 4-pipe designations are not applicable in this facility, as no central air conditioning is provided. The two (2) cast iron boilers, manufactured by American-Standard, were installed in 1953 and are in poor condition. Heating water is distributed to terminal units consisting of unit ventilators, cabinet heaters, unit heaters, air handlers, and fin tubes. The terminal equipment is original to each addition and is in fair to poor condition. The system does not comply with the 15 CFM per person fresh air requirements of the Ohio Building Code mechanical code and Ohio School Design Manual. The pneumatic type system temperature controls are original to each addition, with upgrades in 1999, and are in fair condition. The system does not feature individual temperature controls in all spaces required by the OSDM. The overall system does not feature any central energy recovery systems. The facility is not equipped with louvered interior doors to facilitate Corridor utilization as return air plenums. The existing system is not ducted, except for the Multi-Purpose Room (Student Dining / Gymnasium), and floor to structural deck heights in the 1953 Original Construction will not accommodate the installation of properly sized ductwork for a future Ohio School Design Manual approved system. Floor to structural deck heights in the 1964 Addition and the remainder of the 1953 Original Construction will accommodate the installation of properly sized ductwork for a future Ohio School Design Manual approved system. The existing system in the Multi-Purpose Room (Student Dining / Gymnasium) is ducted, but the ductwork cannot be integrated into a possible future system due to arrangement, air volume, and routing of existing ductwork. The overall heating system is evaluated as not being in safe and efficient working order, and long term life expectancy of the existing system is not anticipated. The structure is not equipped with a central air conditioning system. The site does not contain underground fuel tanks.

Rating: 3 Needs Replacement

Recommendations: Provide new overall heating, ventilating, and air conditioning system to achieve compliance with Ohio Building Code and Ohio School Design Manual standards. Convert the overall facility, except for the Multi-Purpose Room (Student Dining / Gymnasium) to a ducted system to facilitate efficient exchange of conditioned air. Replace existing ductwork in the Multi-Purpose Room (Student Dining / Gymnasium) to facilitate efficient exchange of conditioned air with pricing included in conversion to ducted system replacement. Provide architectural soffits in the 1953 Original Construction Corridors to accommodate the installation of ductwork, with funding provided in conversion to ducted system replacement.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
HVAC System Replacement:	$26.12	sq.ft. (of entire building addition)		Required	Required	$955,600.20	(includes demo of existing system and reconfiguration of piping layout and new controls, air conditioning)
Convert To Ducted System	$8.00	sq.ft. (of entire building addition)		Required	Required	$292,680.00	(includes costs for vert. & horz. chases, cut openings, soffits, etc. Must be used in addition to HVAC System Replacement if the existing HVAC system is non-ducted)
Sum:			$1,248,280.20	$1,106,102.16	$142,178.04		

Natural Gas Fired Heated Water Boilers

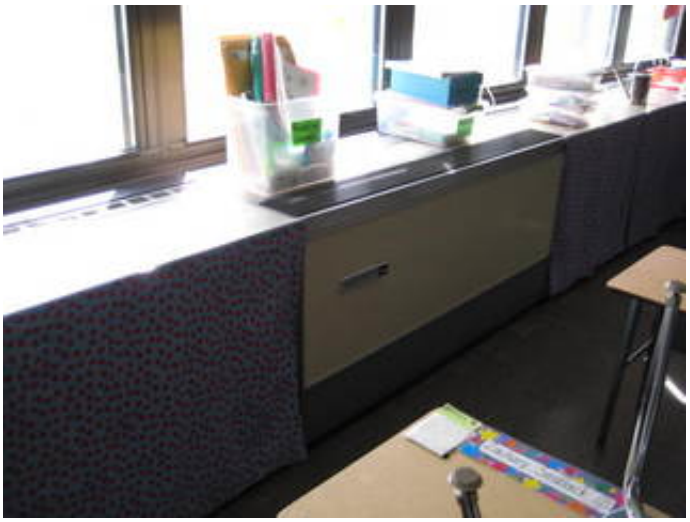

Unit Ventilator

Back to Assessment Summary

B. Roofing

Description: The roof over the overall facility, except for over the Kindergarten Classroom, is an asphalt built-up roof with gravel wear coat system that was installed in 1999, and is in fair condition. The roof over the Kindergarten Classroom is a granulated asphalt rolled roofing system that was installed in 1999, and is in fair condition. There are no District reports of current leaking. Signs of past leaking were observed during the physical assessment. Access to the roof was gained by roof access door that is in poor condition. Fall safety protection cages are not required, and are not provided. There were no observations of standing water on the roof. Metal cap flashings are in fair condition. Roof storm drainage is addressed through a system of roof drains, which are properly located, and in good condition. The roof is not equipped with overflow roof drains, though they are not required. No problems requiring attention were encountered with any roof penetrations. There are not any covered walkways attached to this structure. 06-22-18 Assessment Update: Additional roof insulation required to meet LEED energy efficiency requirements.

Rating: 3 Needs Replacement

Recommendations: The roof over the overall facility requires replacement to meet Ohio School Design Manual guidelines due to condition. The roof access door requires replacement due to condition. Install new exterior roof access ladder required for access to upper roof. 10-02-14 Update: Existing roof was installed over 2 previous roofs. Provide budget for additional roof tear-off. Coping will need replaced as part of roof tear-off and replacement. Provide budget for coping replacement. 06-22-18 Assessment Update: Provide for additional roof insulation to meet LEED energy efficiency requirements.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
Built-up Asphalt:	$13.20	sq.ft. (Qty)		32,418 Required	4,167 Required	$482,922.00	
Repair/replace cap flashing and coping:	$18.40	ln.ft.		1,200 Required	120 Required	$24,288.00	
Roof Insulation:	$3.20	sq.ft. (Qty)		32,418 Required	4,167 Required	$117,072.00	(non-tapered insulation for use in areas without drainage problems)
Other: Add Roof Ladder	$50.00	ln.ft.		10 Required		$500.00	Provide new roof access ladder for Multipurpose space
Other: Replace Roof Access Door	$1,000.00	each		1 Required		$1,000.00	Replace roof access door, frame, and hardware.
Other: Tear-off Additional Roofing System	$2.00	sq.ft. (Qty)		32,418 Required	4,167 Required	$73,170.00	Tear-off Additional Roofing System
Sum:			$698,952.00	$620,071.20	$78,880.80		

Typical Roof On the Overall Facility

Typical Roof With Roof Over the Kindergarten Classroom Beyond

Back to Assessment Summary

C. Ventilation / Air Conditioning

Description: The overall facility is not equipped with a central air conditioning system. Window units are provided in the Principal's Office, Teacher Lounge, and Administrative Offices locations. The ventilation system in the overall facility consists of unit ventilators, original to each addition and in fair condition, providing fresh air to Classrooms, and unit ventilators and air handlers, original to each addition and in fair condition, providing fresh air to other miscellaneous spaces such as the Multi-Purpose Room (Student Dining / Gymnasium) and Media Center. Relief air venting is provided by transfer grilles from the Classrooms, unit ventilators, air handlers, ceiling plenums, and central relief fans. The ventilation system does not meet the Ohio Building Code 15 CFM per occupant fresh air requirement. The overall system is not compliant with Ohio Building Code and Ohio School Design Manual requirements. Dust collection systems are not required in this facility. Exhaust systems for Restrooms, Storage Rooms, Custodial Closets, Maintenance Workrooms, Kitchen Dry Food Storage, Locker Rooms, P.E. Workroom & Storage, and Art Rooms are inadequately placed, and in poor condition. The Art Program is equipped with a kiln located in the Mechanical Room, and the existing kiln ventilation system is adequate. 06-22-18 Assessment Update: General building exhaust is included in Item A and should not be included in this line Item.

Rating: 1 Satisfactory

Recommendations: Provide an air conditioning system to meet with Ohio Building Code and Ohio School Design Manual requirements. Pricing included in Item A. Replace the existing general building exhaust system. 06-22-18 Assessment Update: Delete general building exhaust.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
Sum:			$0.00	$0.00	$0.00		

Window AC Unit

Restroom Ventilation System

Back to Assessment Summary

D. Electrical Systems

Description: The electrical system provided to the 1953 Original Construction is a 120/208 volts, 400 amp, 3 phase and 4 wire system installed in 1953, and is in poor condition. The system in the 1964 Addition is an extension of that found in the 1953 Original Construction. Power is provided to the school by multiple City of Cuyahoga Falls owned, pad-mounted transformers located in a concrete vault outside the Mechanical Room, and in fair condition. The panel system, installed in 1953, is in poor condition, and cannot be expanded to add additional capacity. The Classrooms are not equipped with adequate electrical outlets. The typical Classroom contains five (5) general purpose outlets, zero (0) dedicated outlets for each Classroom computer, and zero (0) dedicated outlets for each Classroom television. Some Classrooms are equipped with as many as six (6) general purpose outlets, while others are equipped with as few as thee (3) general purpose outlets. There are not any spaces that have no electrical outlets. The Corridors are not equipped with adequate electrical outlets for servicing. Adequate GFI protected exterior outlets are not provided around the perimeter of the building. The facility is not equipped with an emergency generator. Adequate lightning protection safeguards are not provided. Stage lighting power system including control panel, breakers, and dimmers is inadequately provided, in poor condition and does not meet OSDM requirements. The overall electrical system does not meet Ohio School Design Manual requirements in supporting the current needs of the school, and will be inadequate to meet the facility's future needs.

Rating: 3 Needs Replacement

Recommendations: The entire electrical system requires replacement to meet Ohio School Design Manual guidelines for overall capacity and Classroom capacity due to age, condition, lack of OSDM-required features, and to accommodate the addition of an air conditioning system. Provide new transformer due to age and condition, with funding to be coordinated with the City of Cuyahoga Falls owned utility company. Provide an emergency generator, with funding included in the electrical system replacement. Provide adequate lightning protection safeguards in the overall facility, including associated grounding system, with funding included in the electrical system replacement.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
System Replacement:	$16.23	sq.ft. (of entire building addition)		Required	Required	$593,774.55	(Includes demo of existing system. Includes generator for life safety systems. Does not include telephone or data or equipment) (Use items below ONLY when the entire system is NOT being replaced)
Sum:			$593,774.55	$526,144.14	$67,630.41		

Main Electrical Distribution Panel

Pad Mounted Transformer Vault

Back to Assessment Summary

E. Plumbing and Fixtures

Description: The service entrance is equipped with two (2) reduced pressure backflow preventers in fair condition. A water treatment system is not provided, though none is needed. The domestic water supply piping in the overall facility is galvanized and copper, is original to each addition, and is in fair condition. The waste piping in the overall facility is cast iron with some galvanized, is original to each addition, and is in fair condition. The facility is equipped with one (1) A.O. Smith natural gas domestic water boiler, installed in 1994, in fair condition, with one (1) separate 450 gallon storage tank, installed in 1969, and in poor condition. The overall facility contains 2 Large Group Restrooms for boys, 2 Large Group Restrooms for girls, 1 Locker Room Restroom for boys, 1 Locker Room Restroom for girls, 0 Locker Room Restrooms for staff, 1 Kitchen Restroom, 1 Health Clinic Restroom, 1 Restrooms associated with Kindergarten / Pre-K Classrooms / Specialty Classrooms, and 2 Restrooms for staff. Boys' Large Group Restrooms contain 6 non-ADA wall mounted flush valve toilets, 8 non-ADA (4 wall / 4 floor) mounted (4 flush valve / 4 central flush) urinals, as well as 4 non-ADA wall mounted lavatories. Girls' Large Group Restrooms contain 11 non-ADA wall mounted flush valve toilets, as well as 4 non-ADA wall mounted lavatories. Boys' Locker Room Restroom contains 1 non-ADA wall mounted flush valve toilet, 1 non-ADA wall mounted lavatory, as well as 4 non-ADA showers. Girls' Locker Room Restroom contains 1 non-ADA wall mounted flush valve toilet, 1 non-ADA wall mounted lavatory, as well as 4 non-ADA showers. Staff Restrooms contain 2 non-ADA wall mounted flush valve toilets, as well as 2 non-ADA wall mounted lavatories. Condition of fixtures is fair to poor. The facility is equipped with 2 non-ADA drinking fountains, as well as 1 ADA electric water cooler, in fair to poor condition. Elementary Classrooms are inadequately equipped with the required lavatory mounted type drinking fountains, which are not ADA compliant, and are in fair to poor condition. Special Education Classroom is not equipped with the required Restroom facilities. Kitchen is equipped with the required Restroom which contains 1 non-ADA wall mounted flush valve toilet, as well as 1 non-ADA wall mounted lavatory, and fixtures are in fair to poor condition. Health Clinic is equipped with the required Restroom which contains 1 non-ADA wall mounted flush valve toilet, as well as 1 non-ADA wall mounted lavatory, and fixtures are in fair to poor condition. Kindergarten / Pre-K Classrooms are equipped with Restroom facilities which contain 1 non-ADA floor mounted flush valve toilet, as well as 1 non-ADA wall mounted lavatory, and fixtures are in fair to poor condition. Kitchen fixtures consist of one (1) double-compartment sink and one (1) dishwashing unit with built-in Hatco water booster heater, which are in fair condition. The Kitchen is not equipped with a satisfactory grease interceptor due to age, condition, insufficient capacity. The Kitchen is not provided the required 140 degree hot water supply. The school meets the OBC requirements for fixtures, except for electric water coolers. Per OBC and OSDM requirements this facility should be equipped with 14 toilets, 4 urinals, 14 lavatories, and 4 electric water coolers, and at present it is equipped with 24 toilets, 8 urinals, 15 lavatories, and 1 electric water cooler. ADA requirements are not met for fixtures and drinking fountains (see Item O). Custodial Closets are properly located and are adequately provided with required service sink or floor drain sink, which is in fair condition. Science Classroom / Lab utility sinks, gas connections, compressed air connections, and safety shower / eyewash are not provided, but are not required due to existing grade configuration. Due to existing grade configuration, no Biology or Chemistry Classroom acid waste systems are required. CONTINUED

Rating: 3 Needs Replacement

Recommendations: Replace galvanized water supply piping in the overall facility with copper piping due to age and condition. Replace sanitary waste piping in the overall facility due to age and condition. To facilitate the school's compliance with OBC and OSFC requirements, provide 13 lavatory mounted type drinking fountains and 3 new electric water coolers. Due to age, condition, and OSFC standards, replace 8 lavatory mounted type drinking fountains, 15 lavatories, 24 toilets, 8 urinals, and 1 electric water cooler. See Item O for replacement of fixtures related to ADA requirements. See Item J for provisions on Kitchen related equipment. Replace the service entrance reduced pressure back flow preventers due to age and condition. Replace the domestic hot water boiler and 450 gallon storage tank due to age and condition. Replace the Kitchen grease trap interceptor due to age, condition, and insufficient capacity. Provide the Kitchen with a water booster heater. Replace the existing Custodial Closet service sinks due to age and condition.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
Back Flow Preventer:	$5,000.00	unit		2 Required		$10,000.00	
Domestic Supply Piping:	$3.50	sq.ft. (of entire building addition)		Required	Required	$128,047.50	(remove / replace)
Sanitary Waste Piping:	$3.50	sq.ft. (of entire building addition)		Required	Required	$128,047.50	(remove / replace)
Domestic Water Heater:	$5,100.00	per unit		1 Required		$5,100.00	(remove / replace)
Toilet:	$1,500.00	unit		24 Required		$36,000.00	(remove / replace) See Item O
Urinal:	$1,500.00	unit		8 Required		$12,000.00	(remove / replace)
Sink:	$1,500.00	unit		15 Required		$22,500.00	(remove / replace)
Electric water cooler:	$3,000.00	unit		4 Required		$12,000.00	(double ADA)
Other: Domestic Hot Water Storage Tank	$3,000.00	per unit		1 Required		$3,000.00	Replace the domestic 450 gallon hot water storage tank due to age and condition.
Other: Kitchen Grease Trap	$5,000.00	per unit		1 Required		$5,000.00	Replace the Kitchen grease trap interceptor due to age, condition, and insufficient capacity.
Other: Kitchen Water Heater	$5,100.00	per unit		1 Required		$5,100.00	Provide the Kitchen with a water booster heater.
Other: Lavatory Mounted Type Drinking Fountain	$1,500.00	per unit		9 Required	4 Required	$19,500.00	To facilitate the school's compliance with OBC and OSFC requirements, provide 13 lavatory mounted type drinking fountains.
Other: Lavatory Mounted Type Drinking Fountain Replacement	$500.00	per unit		8 Required		$4,000.00	Due to age, condition, and OSFC standards, replace 8 lavatory mounted type drinking fountains.
Other: Service Sink	$500.00	per unit		2 Required		$1,000.00	Replace the existing Custodial Closet service sinks due to age and condition.
Sum:			$391,295.00	$356,126.00	$35,169.00		

Floor Mounted Flush Valve Urinals

Domestic Hot Water Boiler and Storage Tank

Back to Assessment Summary

F. Windows

Description: The 1953 Original Construction is equipped with thermally broken aluminum frames with double glazed insulated glazing and insulated panel type window system, which was installed in 2000, and is in good to fair condition. One window opening in the 1953 Original Construction contains Kalwall panels and thermally broken aluminum frames with double glazed insulating glazing, which was installed in 1998, and is in fair condition. The 1963 Addition is equipped with thermally broken aluminum frames with double glazed insulated glazing and insulated panel type window system, which was installed in 2004 and is in good to fair condition. Window system seals are in good condition, with no air and water infiltration being experienced. Window system hardware is in good condition. The window system features surface mounted shades, which are in good to fair condition. The window system is equipped with insect screens on operable windows, which are in good to fair condition. This facility is not equipped with any curtain wall systems. This facility does not feature any glass block windows. The exterior doors in the overall facility are equipped with thermally broken, aluminum frame sidelights and transoms with double glazed insulated glazing, in good condition. The school does not contain skylights. Window security grilles are not provided for ground floor windows. There is no Greenhouse associated with this school. 06-22-18 Assessment Update: The existing windows are in good condition in the 1953 Original Building and 1963 Addition and district personnel reported no issues with the windows; therefore, replacement is not necessary.

Rating: 2 Needs Repair

Recommendations: Replace broken window glazing as required through the overall facility. Replace damaged insect screens as required through the overall facility. Replace damaged surface mounted window shades as required through the overall facility. Replace 1998 windows and Kalwall panels in the 1953 Original Construction. Replace single pane vision panels in exterior doors of the overall facility with approved insulating safety glass. 10-02-14 Update: Exterior finish on windows deteriorated and chalking. Operable sashes not working and seals broke. Revise Window Replacement line item from 0 sf to 6,344 sf at 1953 Original Building and from 0 sf to 288 sf at 1963 Addition. 06-22-18 Assessment Update: Delete window system replacement for 1953 Original Building and 1963 Addition.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
Other: Replace Damaged Insect Screens	$8.00	sq.ft. (Qty)		748 Required	120 Required	$6,944.00	Replace damaged insect screens as required through the overall facility.
Other: Replace Damaged Surface Mounted Blinds	$8.00	sq.ft. (Qty)		1,496 Required	240 Required	$13,888.00	Replace damaged surface mounted window shades as required through the overall facility.
Other: Replace Defective Insulating Glass Panels	$28.00	sq.ft. (Qty)		374 Required	60 Required	$12,152.00	Replace broken window glazing as required through the overall facility.
Other: Replace Kalwall Panels	$28.00	sq.ft. (Qty)		468 Required		$13,104.00	Replace 1998 windows and Kalwall panels in the 1953 Original Construction.
Other: Replace Single Pane Exterior Door Vision Panels	$200.00	each		11 Required	2 Required	$2,600.00	Replace single pane vision panels in exterior doors of the overall facility with approved insulating safety glass.
Sum:			$48,688.00	$43,728.00	$4,960.00		

Typical Classroom Windows in the 1953 Original Construction

Window Opening in the 1953 Original Construction with Kalwall Panels

Back to Assessment Summary

G. Structure: Foundation

Description: The overall facility is equipped with concrete masonry unit foundation walls on concrete footings, which displayed no locations of significant differential settlement, cracking, or leaking, and are in good condition. The District reports that there has been no past leaking. No grading or site drainage deficiencies were noted around the perimeter of the structure that are contributing or could contribute to foundation / wall structural deterioration. 06-22-18 Assessment Update: School district personnel reported, and it was observed, there is storm water infiltration along the North elevation (running east and west) of the classroom wing of 1953 Original Building.

Rating: 2 Needs Repair

Recommendations: Existing conditions require no renovation or replacement at the present time. 06-22-18 Assessment Update: School district personnel reported, and it was observed, there is storm water infiltration along the North elevation (running east and west) of the classroom wing of 1953 Original Building.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
Waterproofing Spray Applied:	$6.00	sq.ft. (Qty)		200 Required		$1,200.00	(include excavation and backfill)
Drainage Tile Systems / Foundation Drainage:	$18.00	ln.ft.		200 Required		$3,600.00	(include excavation and backfill)
Sum:			$4,800.00	$4,800.00	$0.00		

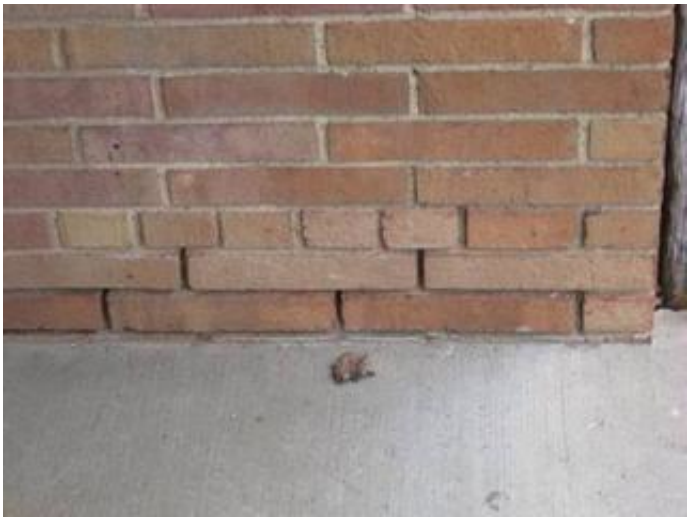

Condition of Exterior Wall at Sidewalk

Typical Condition of Exterior Wall at Grade

Back to Assessment Summary

H. Structure: Walls and Chimneys

Description: The overall facility has a brick veneer on a masonry bearing wall system, which displayed locations of deterioration, and is in good to fair condition. The exterior masonry does not contain control joints. The school does have sufficient expansion joints, and they are in good condition. The exterior masonry has not been cleaned and sealed in recent years and shows evidence of mortar deterioration and locations of efflorescence, graffiti and staining. Architectural exterior accent material consists of stone, which is in fair condition. Interior walls are painted concrete masonry units, glazed block, plaster and metal framed partitions with gypsum board and are in good to fair condition. Interior masonry does not contain control joints. Interior masonry appears to have inadequately spaced and caulked control joints in fair condition. The window sills in the 1953 Original Construction are an element of the aluminum window system, and are in good condition. The window sills in the 1963 Addition are stone and in fair condition. The exterior lintels are steel, and are rusting and in fair condition. The chimney is in fair condition and requires masonry tuckpointing, cleaning and sealing. Soffits at window openings and building entrances are corrugated transite material type construction, and are in fair to poor condition. A loading dock has not been provided to facilitate unloading of trucks and receipt of product / supplies / foodstuffs. The school does have sufficient expansion joints, and they are in good to fair condition.

Rating: 2 Needs Repair

Recommendations: Provide tuckpointing in all areas of mortar deterioration as required through the overall facility. Provide masonry cleaning, sealing and caulking as required through the overall facility. Sawcut and caulk new appropriately spaced control joints in existing masonry through the overall facility. Prep and paint exposed steel lintels through the overall facility. Repoint stone sills in the 1963 Addition. Provide masonry repairs as required through the overall facility. Provide masonry infill for existing unit ventilator openings in exterior walls. Replace existing transite soffits in the 1953 Original Construction. Repair masonry chimney as required. H - Structures Walls and Chimneys: 10-02-14 Update: Corrugated Transite Facia at Gymnasium East Elevation in disrepair. Replace corrugated facia at Gymnasium North Elevation @ Gymnasium. Lintels @ Gymnasium deteriorated. Replace lintels @ gymnasium (40 lf). Significant deterioration of brick veneer @ NE Corner of 1963 Addition. Remove and rebuild NE corner of 1963 Addition (300 sf)

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
Tuckpointing:	$5.25	sq.ft. (Qty)		3,640 Required	456 Required	$21,504.00	(wall surface)
Exterior Masonry Cleaning:	$1.50	sq.ft. (Qty)		14,564 Required	1,827 Required	$24,586.50	(wall surface)
Exterior Masonry Sealing:	$1.00	sq.ft. (Qty)		14,564 Required	1,827 Required	$16,391.00	(wall surface)
Exterior Caulking:	$5.50	ln.ft.		4,384 Required	832 Required	$28,688.00	(removing and replacing)
Replace Brick Veneer System:	$35.00	sq.ft. (Qty)		300 Required		$10,500.00	(total removal and replacement including pinning and shoring)
Lintel Replacement:	$250.00	ln.ft.		40 Required		$10,000.00	(total removal and replacement including pinning and shoring)
Install Control Joints	$60.00	ln.ft.		243 Required	96 Required	$20,340.00	
Other: Chimney Repair	$15.00	sq.ft. (Qty)		260 Required		$3,900.00	Repair masonry chimney as required.
Other: Masonry Infill	$12.75	sq.ft. (Qty)		124 Required	24 Required	$1,887.00	Provide masonry infill for existing unit ventilator openings in exterior walls.
Other: Masonry Repairs	$15.00	sq.ft. (Qty)		2,185 Required	274 Required	$36,885.00	Provide masonry repairs as required through the overall facility
Other: Paint Steel Lintels	$5.00	sq.ft. (Qty)		707 Required	134 Required	$4,205.00	Prep and paint exposed steel lintels through the overall facility.
Other: Prep and Paint Steel Lintels	$8.00	sq.ft. (Qty)		707 Required	134 Required	$6,728.00	Prep and paint exposed steel lintels through the overall facility.
Other: Replace Corrugated Transite Facia	$16.80	sq.ft. (Qty)		432 Required		$7,257.60	Replace Corrugated Transite Facia @ Gymnasium East Elevation
Other: Replace Transite Soffits	$14.60	sq.ft. (Qty)		2,170 Required		$31,682.00	Replace existing transite soffits in the 1953 Original Construction.
Other: Repoint Stone Window Sills	$7.50	ln.ft.			134 Required	$1,005.00	Repoint stone sills in the 1963 Addition.
Sum:			$225,559.10	$201,098.60	$24,460.50		

Exterior Soffits and Walls in the 1953 Original Construction

Typical Condition of Stone Window Sill Joints

Back to Assessment Summary

I. Structure: Floors and Roofs

Description: The floor construction of the base floor of the overall facility is concrete slab-on-grade type construction, and is in good condition. There is no crawl space. The floor construction of the Stage Storage areas is wood deck on wood joist type construction, and is in good condition. There are no intermediate floors in this single story structure. Ceiling to structural deck spaces are sufficient to accommodate HVAC, electrical, and plumbing scopes of work in required renovations. The roof construction of the overall facility, except over the Multipurpose space, is 2'' gypsum plank deck over on steel joist type construction, and is in good condition. The roof construction of the Multipurpose space is 2'' gypsum plank deck over on steel beam type construction, and is in good condition.

Rating: 2 Needs Repair

Recommendations: Provide funding for removal and replacement of non-compliant OBC wood floor structure at the Stage.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
Replace Wood Floor System	$45.00	sq.ft. (Qty)		516 Required		$23,220.00	
Sum:			$23,220.00	$23,220.00	$0.00		

Typical Roof Structure Of the Overall Facility

Non-Compliant OBC Wood Floor Construction

Back to Assessment Summary

J. General Finishes

Description: The overall facility features conventionally partitioned Classrooms with VAT and VCT flooring, acoustical tile ceilings, as well as glazed and painted block wall finishes, and they are in fair to poor condition. The overall facility has Corridors with terrazzo flooring, acoustical tile ceilings, as well as plaster and glazed block wall finishes, and they are in fair condition. The overall facility has Restrooms with terrazzo flooring, plaster ceilings, as well as glazed block wall finishes, and they are in fair to poor condition. Toilet partitions are metal, and are in poor condition. Classroom casework in the overall facility is wood type construction with plastic laminate tops, is inadequately provided, and in poor condition. The typical Classroom contains 8 lineal feet of casework, and Classroom casework provided ranges from 4 to16 feet. Classrooms are provided adequate chalkboards, markerboards, and tackboards, which are in fair condition. The lockers, located in the Corridors, are adequately provided, and in fair condition. The Classroom storage cubbies, located in the Classroom, are adequately provided, and in poor condition. The Art program is equipped with a kiln located in the Boiler Room in fair condition, and existing kiln ventilation is adequate. The facility is equipped with wood non-louvered interior doors that are partially recessed without proper ADA hardware and clearances, and in fair to poor condition. The Gymnasium space has VCT flooring, acoustical tile ceilings, as well as glazed and painted block wall finishes, and they are in fair to poor condition. Gymnasium telescoping stands are wood type construction in fair to poor condition. Gymnasium basketball backboards are fixed type, and are in fair to poor condition. The Media Center, located in the 1953 Original Construction, has carpet flooring, acoustical tile ceilings, as well as painted block, glazed block and gypsum board partitions wall finishes, and they are in fair condition. Student Dining shares the Gymnasium space. OSDM-required fixed equipment for Stage is inadequately provided, and in fair to poor condition. The existing Kitchen is full service, is undersized based on current enrollment, and the existing Kitchen equipment, installed in 1953 with incremental upgrades, is in fair to poor condition. The Kitchen hood is in poor condition, and is not equipped with the required UL 300 compliant wet chemical fire suppression system. The required 6'' overhang on all three exposed sides of the cooking equipment is not provided by the hood. Kitchen hood exhaust ductwork is not of proper construction material and/or installed as required by the OSDM and OBMC. Reach-in coolers and freezers are located within the Kitchen spaces, and are in fair condition. 06-22-18 Assessment Update: Floor infill, patch, floor tile repair and wall tile repair will be required following removal of floor mounted urinals. Stage curtain is old and worn and should be replaced. Wood stage flooring and adjacent storage room is worn and should be replaced. The district recently replaced 3 toilet partitions.

Rating: 3 Needs Replacement

Recommendations: Provide complete replacement of finishes and casework due to installation of systems outlined in Items A, C, D, E, I, K, L, M, N, T, U, and due to condition. Provide for the replacement of interior doors due to condition. Other doors are funded in Item O due to opening expansion. Provide for the replacement of Kitchen equipment due to age and condition. Provide for the replacement of the Kitchen exhaust hood due to age and condition. Provide for the replacement of toilet partitions due to condition. Provide for the replacement of toilet accessories due to condition. Provide for the replacement of Gymnasium seating due to condition. Provide for the replacement of Basketball goals due to condition. J - General Finishes: 10-02-14 Update: Exterior walls are 8'' block with 4'' clay fired brick and no air cavity or insulation. Provide insulation of exterior walls to meet LEED energy requirements. 06-22-18 Assessment Update: Provide budget for floor infill, patch, floor tile repair and wall tile repair for removal of floor mounted urinals. Replace stage curtain. Replace wood stage flooring and adjacent storage room. Revise toilet partitions from 22 to 19.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
Complete Replacement of Finishes and Casework (Elementary):	$15.90	sq.ft. (of entire building addition)		Required	Required	$581,701.50	(elementary, per building area, with removal of existing)
Toilet Partitions:	$1,000.00	per stall		19 Required		$19,000.00	(removing and replacing)
Toilet Accessory Replacement	$0.20	sq.ft. (of entire building addition)		Required		$6,483.60	(per building area)
Door, Frame, and Hardware:	$1,300.00	each		21 Required	4 Required	$32,500.00	(non-ADA)
Basketball Backboard Replacement	$6,500.00	each		2 Required		$13,000.00	(electric)
Bleacher Replacement	$110.00	per seat		386 Required		$42,460.00	(based on current enrollment)
Kitchen Exhaust Hood:	$56,000.00	per unit		1 Required		$56,000.00	(includes fans, exhaust & ductwork)
Total Kitchen Equipment Replacement:	$190.00	sq.ft. (Qty)		789 Required		$149,910.00	(square footage based upon only existing area of food preparation, serving, kitchen storage areas and walk-ins. Includes demolition and removal of existing kitchen equipment)
Other: Floor Infill	$3,000.00	lump sum		Required		$3,000.00	Floor infill and wall and floor tile repair following floor mounted urinal removal.
Other: Insulation for Exterior Walls	$7.00	sq.ft. (Qty)		14,564 Required	1,827 Required	$114,737.00	Furring of exterior walls to meet LEED energy requirements (includes furring, insulation and abuse resistant GWB up to roof deck)
Other: Stage Curtain	$75,000.00	lump sum		Required		$75,000.00	Replace stage curtain
Other: Wood Flooring	$12.85	sq.ft. (Qty)		940 Required		$12,079.00	Replace wood flooring at statge and adjacent storage room
Sum:			$1,105,871.10	$1,021,626.80	$84,244.30		

Typical Corridor Finishes

Lockers located in the Corridors

Back to Assessment Summary

K. Interior Lighting

Description: The typical Classrooms in the 1953 Original Construction are equipped with some T-8 1x4 suspended and T-8 2x4 lay-in direct fluorescent fixtures with single level switching. Classroom fixtures are in fair condition, providing an average illumination of 58 FC, thus complying with the 50 FC recommended by the OSDM. The typical Classrooms in the 1964 Addition are equipped with T-8 1x4 surface mount fluorescent fixtures with single level switching. Classroom fixtures are in fair condition, providing an average illumination of 38 FC, which is less than the 50 FC recommended by the OSDM. The typical Corridors in the overall facility are equipped with T-8 1x4 lay-in direct fluorescent fixtures with single level switching. Corridor fixtures are in fair to poor condition, providing an average illumination of 10 FC, which is less than the 20 FC recommended by the OSDM. The Multi-Purpose Room (Student Dining / Gymnasium) spaces are equipped with recessed and surface mount metal halide type lighting, in poor condition, providing an average illumination of 20 FC, which is less than the 50 FC recommended by the OSDM. The Media Center is equipped with T-8 2x4 lay-in direct fluorescent fixture type lighting in fair condition, providing an average illumination of 61 FC, thus complying with the 50 FC recommended by the OSDM. The Student Dining and Gymnasium spaces are incorporated into the Multi-Purpose Room (Student Dining / Gymnasium). The Kitchen spaces are equipped with T-8 2x4 lay-in direct fluorescent fixture type lighting with single level switching. Kitchen fixtures are in good condition, providing an average illumination of 76 FC, thus complying with the 75-80 FC recommended by the OSDM. The Service Areas in the overall facility are equipped with incandescent and T-8 1x4 surface mount fluorescent fixture type lighting in fair condition, providing inadequate illumination. The typical Administrative spaces in the overall facility are equipped with T-8 2x4 lay-in direct fluorescent fixture type lighting in good condition, providing adequate illumination based on OSDM requirements. The overall lighting systems of the facility are not compliant with Ohio School Design Manual requirements due to age, condition, inadequate lighting levels, lack of multi-level switching, and the utilization of incandescent fixtures. 06-22-18 Assessment Update: The school district recently replaced lights in the corridors. However, due to system replacement (i.e.; hvac, electric, fire suppression) and above ceiling work complete lighting replacement to include the recent corridor lights required. Therefore, no change in scope and budget necessary.

Rating: 3 Needs Replacement

Recommendations: Provide complete replacement of lighting system due to age, condition, inadequate lighting levels, lack of multilevel switching, the utilization of incandescent fixtures, and installation of systems outlined in Items A, C, J, and U. 06-22-18 Assessment Update: The school district recently replaced lights in the corridors. However, due to system replacement (i.e.; hvac, electric, fire suppression) and above ceiling work complete lighting replacement to include the recent corridor lights required. Therefore, no change in scope and budget necessary.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
Complete Building Lighting Replacement	$5.00	sq.ft. (of entire building addition)		Required	Required	$182,925.00	Includes demo of existing fixtures
Sum:			$182,925.00	$162,090.00	$20,835.00		

Corridor Fluorescent Light Fixtures

Multi-Purpose Room (Student Dining / Gymnasium) Light Fixtures

Back to Assessment Summary

L. Security Systems

Description: The overall facility contains a Honeywell motion sensor and door contact type security system in fair to poor condition. Motion detectors are inadequately provided in main entries, central gathering areas, offices, main Corridors, and spaces where 6 or more computers are located. Exterior doors are adequately equipped with door contacts. An automatic visitor control system is not provided. Compliant color CCTV cameras are not provided at main entry areas, parking lots, central gathering areas, and main Corridors. A compliant computer controlled access control system integrating alarms and video signals, with appropriate UPS backup, is not provided. The system is not equipped with card / biometric readers. The security system is inadequately provided throughout, and the system is not fully compliant with Ohio School Design Manual guidelines. Existing playground fencing is not fully compliant with Ohio School Design Manual guidelines. The exterior site lighting system is equipped with surface mounted HID high pressure sodium / mercury vapor entry lights in fair condition. Pedestrian walkways are not illuminated. Parking and bus pick-up / drop off areas are not illuminated. The exterior site lighting system provides inadequate coverage. 06-22-18 Assessment Update: The main office is interior to the building and the main entry does not provide for adequate security. Modifications are required to achieve a secure main entrance into the building.

Rating: 3 Needs Replacement

Recommendations: Provide complete replacement of security system to meet Ohio School Design Manual guidelines. Provide complete replacement of exterior site lighting system to meet Ohio School Design Manual guidelines. Provide additional playground fencing to meet Ohio School Design Manual guidelines, funding included in complete replacement of security system. 06-22-18 Assessment Update: Provide for modifications on existing main entrance to provide for a security vestibule.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
Security System:	$1.85	sq.ft. (of entire building addition)		Required	Required	$67,682.25	(complete, area of building)
Exterior Site Lighting:	$1.00	sq.ft. (of entire building addition)		Required	Required	$36,585.00	(complete, area of building)
Other: Security Vestibule	$60,000.00	lump sum		Required		$60,000.00	Modify main entry to provide for a security vestibule.
Sum:			$164,267.25	$152,391.30	$11,875.95		

Security System Motion Detection Device

Surface Mounted HID High Pressure Sodium / Mercury Vapor Light Fixture

Back to Assessment Summary

M. Emergency/Egress Lighting

Description: The overall facility is equipped with an emergency egress lighting system consisting of non compliant plastic construction exit signs, as well as OSDM compliant red lettered, cast aluminum construction, and LED illuminated exit signs and the system is in fair condition. The facility is not adequately equipped with emergency egress floodlighting and the system is in fair to poor condition. The system is not provided with appropriate battery backup and emergency generator on separate circuits. The system is inadequately provided throughout, and does not meet Ohio School Design Manual and Ohio Building Code requirements.

Rating: 3 Needs Replacement

Recommendations: Provide complete replacement of emergency / egress lighting system to meet Ohio School Design Manual guidelines.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
Emergency/Egress Lighting:	$1.00	sq.ft. (of entire building addition)		Required	Required	$36,585.00	(complete, area of building)
Sum:			$36,585.00	$32,418.00	$4,167.00		

Compliant Illuminated Exit Sign

Emergency Egress Light Fixture

Back to Assessment Summary

N. Fire Alarm

Description: The overall facility is equipped with an addressable Gamewell Flex 610 fire alarm system, installed in 1999, and in good to fair condition, consisting of manual pull stations, smoke detectors, and horn and strobe indicating devices. The system is automatic and is monitored by a third party. The system is not equipped with sufficient audible horns, strobe indicating devices, and smoke detectors. The system is not equipped with any flow switches,tamper switches, or heat sensors. The system thus will not support future fire suppression systems. The system is not adequately provided throughout, and does not have additional zone capabilities. The system is not fully compliant with Ohio Building Code, NFPA, and Ohio School Design Manual requirements.

Rating: 3 Needs Replacement

Recommendations: Provide complete replacement of fire alarm system to meet OBC, NFPA, and Ohio School Design Manual guidelines.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
Fire Alarm System:	$1.75	sq.ft. (of entire building addition)		Required	Required	$64,023.75	(complete new system, including removal of existing)
Sum:			$64,023.75	$56,731.50	$7,292.25		

Fire Alarm System Horn and Strobe Indication Device

Fire Alarm System Smoke Detection Device

Back to Assessment Summary

O. Handicapped Access

Description: At the site, there is an accessible route provided from the public right-of-way, the accessible parking areas, and from the passenger unloading zone to the main entrance of the school. There is an accessible route connecting all or most areas of the site. The exterior entrances are ADA accessible. Access from the parking / drop-off area to the building entries is not compromised by steps or steep ramps. Adequate handicap parking is provided. Exterior doors are equipped with ADA hardware. The main entry is not equipped with an ADA power assist door. Playground layout and equipment are mostly compliant. On the interior of the building, space allowances and reach ranges are not compliant. There is an accessible route through the building which does include protruding objects. Ground and floor surfaces are compliant. Steps do not meet all ADA requirements, and are insufficient due to handrails and space allowances at entries to steps. Elevation changes within the overall facility are facilitated by non-compliant steps at the stage in fair condition. Access to the Stage is not facilitated by a chair lift or ramp. Interior doors of the overall facility are semi- recessed, are not provided adequate clearances, and are not provided with ADA-compliant hardware. 11 ADA-compliant toilets are required, and none are currently provided. 11 ADA-compliant lavatories are required, and none are currently provided. 3 ADA-compliant urinals are required, and 2 are currently provided. No ADA-compliant showers are required for this grade level, and none are currently provided. Two ADA-compliant electric water coolers are required, and one is currently provided. Toilet partitions are metal, and do not provide appropriate ADA clearances. ADA-compliant accessories are not adequately provided and mounted. Mirrors do meet ADA requirements for mounting heights. Sink base casework in the Classrooms do not meet ADA clearances. Health Clinic, Kitchen, Staff and Kindergarten Restrooms are not compliant with ADA requirements due to lack of clearances and ADA accessories. A Special Education Restroom is not provided. ADA signage is provided on both the interior and the exterior of the building. 06-22-18 Assessment Update: Due to renovation work scope the existing ADA signage will likely be damages and the design solution may revise signage; therefore, replacement is recommended.

Rating: 2 Needs Repair

Recommendations: Provide an ADA-compliant power assist door opener, 1 chair lift, 1 electric water cooler, 6 toilets, 6 sinks, 1 urinal, 6 toilet accessories, 27 doors and frames in the overall facility to facilitate the school's meeting of ADA requirements. Add new ADA compliant handrails at steps to the Stage. Provide funding for removal of existing glazed block screen walls in both Student Locker Restrooms. Enlarge and reconfigure 4 new single ADA Toilet Rooms for the Kitchen, Health Clinic, Staff, and Kindergarten, including 4 toilets, 4 sinks and 4 sets of ADA accessories. Add 1 new single ADA Toilet Room for the Special Education Classroom, including 1 toilet, 1 sink, and 1 set of ADA accessories. Toilet partitions issues are corrected in Item J. ADA compliant sink base casework in the Classrooms are corrected in Item J. For interior doors that are not being replaced under this Item, door hardware to be replaced with funding provided in Item J. 10-02-14 Update: Change handicapped restroom conversion allowance from $10,000 for each restroom to $16,761.00 for each restroom. Add Allowance of $25,707.00 for converting space to handicapped accessible Family Restroom.06-22-18 Assessment Update: Replace ADA signage with new

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
Lifts:	$15,000.00	unit		1 Required		$15,000.00	(complete)
Electric Water Coolers:	$1,800.00	unit		1 Required		$1,800.00	(replacement double ADA)
Toilet/Urinals/Sinks:	$1,500.00	unit		13 Required		$19,500.00	(replacement ADA)
ADA Assist Door & Frame:	$7,500.00	unit		1 Required		$7,500.00	(openers, electrical, patching, etc)
Replace Doors:	$5,000.00	leaf		23 Required	4 Required	$135,000.00	(rework opening and corridor wall to accommodate ADA standards when door opening is set back from edge of corridor and cannot accommodate a wheelchair.)
Provide Toilet Accessories:	$1,000.00	per restroom		4 Required		$4,000.00	
Other: Add Accessible Family Restroom	$25,707.00	each		1 Required		$25,707.00	Add Family Rest Room to meet ADA requirements (includes fixtures, walls, door and hardware, floor drain, and supply lines from nearby existing Restroom).
Other: Add Handrails	$20.00	ln.ft.		42 Required		$840.00	Add/Replace ADA Compliant handrails at the steps to the Stage
Other: Enlarge existing Restroom to meet ADA requirements	$16,761.00	each		4 Required		$67,044.00	Enlarge existing Restroom to meet ADA requirements
Sum:			$276,391.00	$256,391.00	$20,000.00		

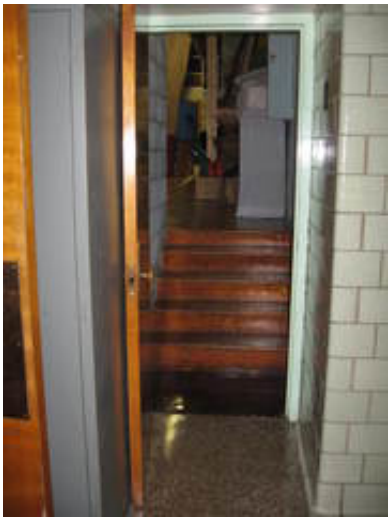

Narrow Opening and Steps At the Stage

Drinking Fountain and Staff Toilet

Back to Assessment Summary

P. Site Condition

Description: The 8.5 acre relatively flat site is located in a suburban residential setting with moderate tree, shrub, floral landscaping. There are no outbuildings. There are no apparent problems with erosion or ponding. The site is bordered by lightly traveled city streets. A single entrance onto the site impedes proper separation of bus and other vehicular traffic, and one way bus traffic is provided. A bus loop is provided for student loading and unloading, although it is not separate from the staff and visitor parking. Staff and visitor parking is facilitated by an asphalt parking lot in poor condition, containing 44 parking places, which provides adequate parking for staff members, visitors, and the disabled. The site and parking lot drainage design, consisting of sheet drainage and catch basins, provides adequate evacuation of storm water, and no problems with parking lot ponding were observed. Concrete curbs are not located as required. Concrete sidewalks are properly sloped, are located to provide a logical flow of pedestrian traffic, and are in fair condition. Trash pick-up and service drive pavement is heavy duty and is in fair condition, and is not equipped with a concrete pad area for dumpsters. There are no exterior steps or handrails associated with this facility. Site fencing is partially provide, however the Playground and athletic fields are not separated from vehicular traffic. The playground equipment is primarily constructed of coated steel and high density plastic, is in good to fair condition, with some in fair to poor condition, placed to provide compliant fall zones, and on a compliant mulch soft surface of insufficient depth, with a basketball court being provided on an asphalt surface. The playground area is equipped with sufficient benches in fair condition. The athletic facilities are comprised of a baseball field and a small multi-purpose field, and are in good condition. Site features are suitable for outdoor instruction, which is enhanced through the District's provision of benches. There is an area of approximately 20,000 SF to the east of the building where a small athletic field is located. 06-22-18 Assessment Update: The existing playground equipment is a mix of mismatched pieces installed over time and the older pieces are beginning to deteriorated and show wear and should be replaced. The existing front parking lot and drive are scheduled for replacement this summer; therefore, the asphalt replacement quantity can be reduced.

Rating: 2 Needs Repair

Recommendations: Provide a new concrete dumpster pad. Provide for the replacement of the asphalt pavement due to condition. Replace concrete sidewalks as required due to condition. Add concrete curbs as required to provide proper separation of pedestrian and vehicular traffic. Provide additional Playground mulch as the soft surface material to allow for a sufficient depth. Provide site contingency allowances for unforeseen conditions. 06-22-18 Assessment Update: Replace playground equipment. Reduce asphalt replacement quantity by 4,178 sq yards.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
Playground Equipment:	$1.50	sq.ft. (Qty)		32,418 Required	4,167 Required	$54,877.50	(up to $100,000, per sq.ft. of school)
Removal of existing Playground Equipment:	$2,000.00	lump sum		Required		$2,000.00	
Replace Existing Asphalt Paving (heavy duty):	$30.60	sq. yard		7,478 Required	924 Required	$257,101.20	(including drainage / tear out for heavy duty asphalt)
Concrete Curb:	$18.00	ln.ft.		303 Required	37 Required	$6,120.00	(new)
Concrete Sidewalk:	$4.69	sq.ft. (Qty)		192 Required	24 Required	$1,013.04	(5 inch exterior slab)
Provide Soft Surface Playground Material:	$30.00	sq. yard		897 Required	111 Required	$30,240.00	
Provide Concrete Dumpster Pad:	$2,400.00	each		1 Required		$2,400.00	(for two dumpsters)
Base Sitework Allowance for Unforeseen Circumstances	$50,000.00	allowance		Required		$50,000.00	Include this and one of the next two. (Applies for whole building, so only **one** addition should have this item)
Sitework Allowance for Unforeseen Circumstances for buildings between 0 SF and 100,000 SF	$1.50	sq.ft. (of entire building addition)		Required	Required	$54,877.50	Include this one **or** the next. (Each addition should have this item)
Other: Asphalt Replacement Deduct	-$30.60	sq. yard		4,178 Required		-$127,846.80	Reduce asphalt quantity to account for replacement work scheduled to be complete summer 2018.
Sum:			$330,782.44	$285,898.48	$44,883.96		

Playground Equipment

Sitting Area

Back to Assessment Summary

Q. Sewage System

Description: The sanitary sewer system is tied in to the city system, and is in good to fair condition. No significant system deficiencies were reported by the school district or noted during the physical assessment. 06-22-18 Assessment Update: District personnel reported ongoing problems with main sanitary sewer with collapsing pipe.

Rating: 2 Needs Repair

Recommendations: Existing conditions require no renovation or replacement at the present time. 06-22-18 Assessment Update: Replace underground sanitary sewer to include adding a manhole.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
Sewage Main:	$45.00	ln.ft.		550 Required		$24,750.00	(include excavation and backfilling)
Other: Manhole	$15,000.00	lump sum		Required		$15,000.00	Provide sanitary sewer manhole
Sum:			$39,750.00	$39,750.00	$0.00		

Sanitary Waste Piping

Kitchen Grease Trap Interceptor

Back to Assessment Summary

R. Water Supply

Description: The domestic water supply system is tied in to the city system, features 3" service and 1 1/2" water meter, and is in fair condition. The District was not able to provide water supply flow test data. The existing domestic water service appears to meet the facility's current needs. The facility is not equipped with an automated fire suppression system, and the existing water supply will not provide adequate support for a future system. The domestic water service is not equipped with a water booster pump, and none is required. The system does not provide adequate pressure and capacity for the future needs of the school.

Rating: 1 Satisfactory

Recommendations: Provide a new city water supply line of adequate capacity to support the existing needs of the facility, as well as a future automated fire suppression system. Funding provided in Item U.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
Sum:			$0.00	$0.00	$0.00		

Incoming Domestic Water Service Line

Incoming Domestic Water Service Meter

Back to Assessment Summary

S. Exterior Doors

Description: Typical exterior doors in the overall facility are hollow metal type construction, installed on hollow metal frames, and in fair condition. Typical exterior doors feature single glazed tempered glass or no vision panels. Entrance doors in the overall facility are aluminum FRP type construction, installed on aluminum frames, and in good condition. Entrance doors feature single glazed tempered glass vision panels. There are no overhead doors in the facility. 06-22-18 Assessment Update: 8 of the noted doors to be painted are in a condition that warrants replacement

Rating: 2 Needs Repair

Recommendations: Paint all exterior hollow metal doors and frames. Replacement of single glazed door vision panels is addressed in Item F. 06-22-18 Assessment Update: Provide for replacement of 2 doors. Revise painting or exterior doors from 5 to 3.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
Door Leaf/Frame and Hardware:	$2,000.00	per leaf		2 Required		$4,000.00	(includes removal of existing)
Other: Prep and Paint Exterior Hollow Metal Doors and Frames	$250.00	each		3 Required		$750.00	Paint all exterior hollow metal doors and frames.
Sum:			$4,750.00	$4,750.00	$0.00		

Main Entry Doors to the 1953 Original Construction

Exterior Hollow Metal Doors in the 1953 Original Construction

Back to Assessment Summary

T. Hazardous Material

Description: The School District did not provided an AHERA three year reinspection reports, or other documents regarding hazardous materials. An Enhanced Environmental Hazards Assessment (EEHA) will need to be conducted in order to establish abatement budgets. Vinyl asbestos floor tile and mastic and ceiling tile containing hazardous materials are located in the overall facility in fair condition. These materials were open to observation and found to be in non-friable condition with light damage. There are no underground storage tanks on the site. Due to the construction date, there is a potential for lead based paint. Fluorescent lighting will require special disposal.

Rating: 3 Needs Replacement

Recommendations: Remove all hazardous materials, inclusive of asbestos-containing materials in the overall facility, as noted in the attached Environmental Hazards Assessment. Provide for the testing of paint that has the potential of being lead-based. Provide for disposal of fluorescent lighting.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
Environmental Hazards Form				EEHA Form	EEHA Form	—	
Breeching Insulation Removal	$10.00	sq.ft. (Qty)		75 Required	0 Required	$750.00	
Estimated Cost For Abatement Contractor to Perform Lead Mock-Ups	$1.00	per unit		5,000 Required	0 Required	$5,000.00	
Special Engineering Fees for LBP Mock-Ups	$1.00	per unit		5,000 Required	0 Required	$5,000.00	
Fluorescent Lamps & Ballasts Recycling/Incineration	$0.10	sq.ft. (Qty)		32,418 Required	4,167 Required	$3,658.50	
Pipe Insulation Removal	$10.00	ln.ft.		700 Required	0 Required	$7,000.00	
Pipe Fitting Insulation Removal	$20.00	each		50 Required	0 Required	$1,000.00	
Pipe Insulation Removal (Hidden in Walls/Ceilings)	$15.00	ln.ft.		650 Required	100 Required	$11,250.00	
Dismantling of Boiler/Furnace/Incinerator	$2,000.00	each		2 Required	0 Required	$4,000.00	
Fire Door Removal	$100.00	each		2 Required	0 Required	$200.00	See S
Non-ACM Ceiling/Wall Removal (for access)	$2.00	sq.ft. (Qty)		3,600 Required	400 Required	$8,000.00	See J
Resilient Flooring Removal, Including Mastic	$3.00	sq.ft. (Qty)		20,000 Required	3,100 Required	$69,300.00	See J
Carpet Removal (over RFC)	$1.00	sq.ft. (Qty)		350 Required	0 Required	$350.00	See J
Acoustical Tile Mastic Removal	$3.00	sq.ft. (Qty)		0 Required	3,100 Required	$9,300.00	
Sink Undercoating Removal	$100.00	each		0 Required	4 Required	$400.00	
Other: EHA Other Hazard	$1.00	per unit		3,000 Required		$3,000.00	XRF testing for lead-based paint is recommended for compliance with EPA's RRP Program.
Sum:			$128,208.50	$106,491.80	$21,716.70		

VAT

Ceiling Tile

Back to Assessment Summary

U. Life Safety

Description: The overall facility is not equipped with an automated fire suppression system. Exit corridors are situated such that dead-end corridors are not present. Stair towers and guardrails are not present in this single story structure. The facility does not have any exterior stairways from intermediate floors. The Mechanical Room and Stage handrails do not extend past the top and bottom stair risers as required by the Ohio Building Code. Mechanical Room guardrails are constructed in a ladder effect and do not meet the 4'' ball test. The Kitchen hood is in poor condition, and is not equipped with the required UL 300 compliant wet chemical fire suppression system. The required 6'' overhang of the cooking equipment is not provided by the hood. Kitchen hood exhaust ductwork is not of proper construction, material, insulation, and was not installed as required by the OSDM and OBCMC. The cooking equipment is not interlocked to shut down in the event of discharge of the fire suppression system. Fire extinguishers are not provided in sufficient quantity. Existing fire extinguishers are inadequately spaced. The facility is not equipped with an emergency generator. The existing water supply is provided by a tie-in to the city system, and is insufficient to meet the future fire suppression needs of the school. Rooms with a capacity greater than 50 occupants are equipped with adequate egress. 06-22-18 Assessment Update: Water meter not required new water line service for fire suppression system. Backflow preventer required for new fire line service for fire suppression system. Handrails at stage stairs required.

Rating: 3 Needs Replacement

Recommendations: Provide new automated fire suppression system to meet Ohio School Design Manual guidelines. Provide increased water service of a capacity sufficient to support the fire suppression system, with funding included in fire suppression funding. Provide new emergency generator, with funding provided via complete replacement of electrical system in Item D. Provide new handrails to meet the requirements of the Ohio Building Code. Provide new guardrails to meet the requirements of the Ohio Building Code. Provide additional wall cabinets and fire extinguishers. Provide the new Kitchen hood with a UL 300 compliant wet chemical fire suppression system, with funding provided in Item J. Provide the interlock to de-energize cooking equipment upon discharge of the Kitchen hood fire suppression system, with funding provided in Item J. 10-02-14 Update: Existing 3'' water service not sufficient to support sprinkler system. Provide new water service for fire protection. Water meter is 1-12'' and will need to be increased in size to meet fire protection flow requirements. Replace water meter. 06-22-18 Assessment Update: Delete water meter. Add a backflow preventer to support new fire line service for fire suppression system. Revise handrail quantity from 1 to 2 to provide handrail at stage stairs.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
Sprinkler / Fire Suppression System:	$3.20	sq.ft. (Qty)		32,418 Required	4,167 Required	$117,072.00	(includes increase of service piping, if required)
Water Main	$40.00	ln.ft.		200 Required		$8,000.00	(new)
Handrails:	$5,000.00	level		2 Required		$10,000.00	
Provide Fire Extinguisher and Wall Cabinet:	$585.00	each		1 Required		$585.00	(includes preparation of wall to receive recessed cabinet)
Other: Backflow Preventer	$15,000.00	lump sum		Required		$15,000.00	Backflow Preventor for new dedicated water line for fire suppression system
Other: Handrails / Guardrails	$34.50	ln.ft.		30 Required		$1,035.00	Provide new handrails to meet the requirements of the Ohio Building Code.
Sum:			$151,692.00	$138,357.60	$13,334.40		

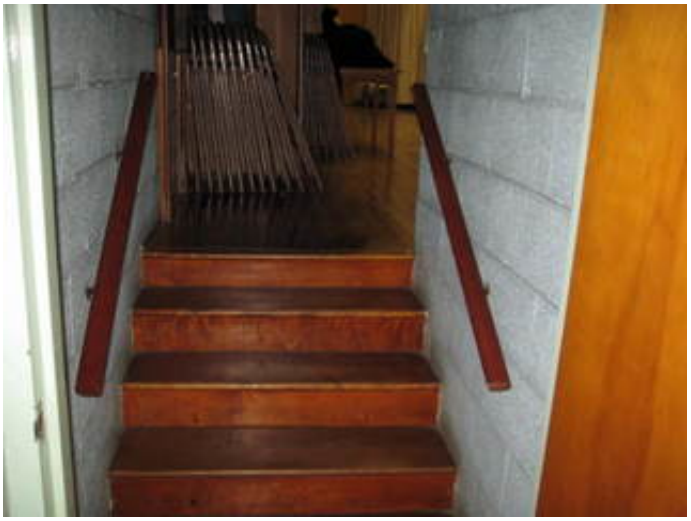

Stage Non-compliant Handrails

Wall Cabinet and Fire Extinguisher

Back to Assessment Summary

V. Loose Furnishings

Description: The typical Classroom furniture is mismatched, and in generally fair to poor condition, consisting of student desks & chairs, teacher desks & chairs, full height file cabinets, reading tables, bookcases, and wastebaskets. The facility's furniture and loose equipment were evaluated in item 6.17 in the CEFPI section of this report, and on a scale of 1 to 10 the overall facility received a rating of 3 due to observed conditions, and due to the fact that it lacks some of the Design Manual required elements.

Rating: 3 Needs Replacement

Recommendations: Provide for replacement of outdated or inadequate furnishings.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
CEFPI Rating 0 to 3	$5.00	sq.ft. (of entire building addition)		Required	Required	$182,925.00	
Sum:			$182,925.00	$162,090.00	$20,835.00		

Typical Teacher Desk

Typical Student Desks

Back to Assessment Summary

W. Technology

Description: The typical Classroom is equipped with one of the required four technology data ports for student use, one data port for teacher use, one voice port with a digitally based phone system / one cable port and monitor, and a 2-way PA system that can only be initiated by the Main Office to meet Ohio School Design Manual requirements. The typical Classroom is not equipped with three of the required four technology data ports for student use and a 2-way PA system that can be initiated by either party to meet Ohio School Design Manual requirements. The facility is equipped with a centralized clock system that only operates three clocks and the school bell system. Specialized electrical / sound system requirements of Gymnasium, Stage, Student Dining, and Music spaces are inadequately provided, and in fair condition. OSDM-compliant computer network infrastructure is not provided. The facility does not contain a Media Distribution Center, and does not provide Computer Labs for use by students.

Rating: 3 Needs Replacement

Recommendations: Provide complete replacement of technology systems to meet Ohio School Design Manual requirements.

Item	Cost	Unit	Whole Building	Original Construction (1953) 32,418 ft²	Classroom Addition (1963) 4,167 ft²	Sum	Comments
ES portion of building with total SF < 50,000	$13.18	sq.ft. (Qty)		32,418 Required	4,167 Required	$482,190.30	
Sum:			$482,190.30	$427,269.24	$54,921.06		

Music Space Sound System

Non-Compliant OSFC Computer Network Infrastructure

Back to Assessment Summary

X. Construction Contingency / Non-Construction Cost

Renovation Costs (A-W)		$6,384,930.19
7.00%	Construction Contingency	$446,945.11
Subtotal		$6,831,875.30
16.29%	Non-Construction Costs	$1,112,912.49
Total Project		**$7,944,787.79**

Construction Contingency	$446,945.11
Non-Construction Costs	$1,112,912.49
Total for X.	**$1,559,857.60**

Non-Construction Costs Breakdown		
Land Survey	0.03%	$2,049.56
Soil Borings / Phase I Envir. Report	0.10%	$6,831.88
Agency Approval Fees (Bldg. Code)	0.25%	$17,079.69
Construction Testing	0.40%	$27,327.50
Printing - Bid Documents	0.15%	$10,247.81
Advertising for Bids	0.02%	$1,366.38
Builder’s Risk Insurance	0.12%	$8,198.25
Design Professional’s Compensation	7.50%	$512,390.65
CM Compensation	6.00%	$409,912.52
Commissioning	0.60%	$40,991.25
Non-Construction Contingency (includes partnering and mediation services)	1.12%	$76,517.00
Total Non-Construction Costs	**16.29%**	**$1,112,912.49**

Back to Assessment Summary

Name of Appraiser	Jeff Tuckerman	**Date of Appraisal**	2015-01-06
Building Name	Elizabeth Price Elementary		
Street Address	2610 Delmore Street		
City/Town, State, Zip Code	Cuyahoga Falls, OH 44221		
Telephone Number(s)	(330) 920-3635		
School District	Cuyahoga Falls City		

Setting: Suburban

Site-Acreage	8.50	Building Square Footage	36,585
Grades Housed	K-5	Student Capacity	293
Number of Teaching Stations	23	Number of Floors	1
Student Enrollment	386		
Dates of Construction	1953,1963		

Energy Sources:	☐ Fuel Oil	☑ Gas	☑ Electric	☐ Solar
Air Conditioning:	☐ Roof Top	☑ Windows Units	☐ Central	☐ Room Units
Heating:	☑ Central	☐ Roof Top	☐ Individual Unit	☐ Forced Air
	☑ Hot Water	☐ Steam		

Type of Construction	**Exterior Surfacing**	**Floor Construction**
☑ Load bearing masonry	☑ Brick	☐ Wood Joists
☐ Steel frame	☐ Stucco	☐ Steel Joists
☐ Concrete frame	☐ Metal	☑ Slab on grade
☐ Wood	☐ Wood	☐ Structural slab
☑ Steel Joists	☑ Stone	

Back to Assessment Summary

Bottom of page

Suitability Appraisal of **1.0 The School Site** for Elizabeth_Price_ES_June_2009_Jan_2015_EEA_June_2018_Desktop_Update

1.0 The School Site	Points Allocated	Points
1.1 **Site is large enough** to meet educational needs as defined by state and local requirements	25	*15*
The site is 8.5 acres compared to 14 acres recommended by the OSDM.		
1.2 **Site is easily accessible** and conveniently located for the present and future population	20	*16*
The School is centrally located within the School District, and is easily accessible.		
1.3 **Location** is removed from undesirable business, industry, traffic, and natural hazards	10	*8*
The site is adjacent to residential uses, and there are no undesirable features adjacent to the School site.		
1.4 Site is **well landscaped and developed** to meet educational needs	10	*8*
The site is moderately landscaped with mature shade trees, ornamental trees, and shrubs which define the property and emphasize the building entrance. Lawn areas where mowing is required do not exceed 3:1 slope.		
1.5 ES Well equipped **playgrounds are separated** from streets and parking areas MS Well equipped **athletic and intermural areas are separated** from streets and parking HS Well equipped **athletic areas** are adequate with sufficient solid-surface parking	10	*6*
Playground areas consist of coated steel and high density plastic type play equipment, which is in good to fair condition, and is located on wood fiber mulch which is an approved soft surface material. Play equipment is ADA accessible, and includes an accessible route to equipment. Fencing is partially provided, but does not provide proper separation of play areas from vehicular use areas.		
1.6 **Topography** is varied enough to provide desirable appearance and without steep inclines	5	*4*
The site is gently sloped to provide positive drainage across the site. A flat area is provided to accommodate buildings, perimeter walks, vehicular circulation, parking areas, outdoor play areas, and physical education spaces, and is desirable.		
1.7 Site has stable, well drained **soil free of erosion**	5	*4*
Soils appear to be stable and well drained, and no erosion was observed.		
1.8 Site is suitable for **special instructional needs**, e.g., outdoor learning	5	*4*
The site has been developed to accommodate outdoor learning, including benches and picnic tables to facilitate instruction.		
1.9 **Pedestrian services** include adequate sidewalk with designated crosswalks, curb cuts, and correct slopes	5	*4*
Sidewalks are adequately provided to accommodate safe pedestrian circulation including designated crosswalks, curb cuts, and correct slopes.		
1.10 ES/MS Sufficient **on-site, solid surface parking** for faculty and staff is provided HS Sufficient **on-site, solid surface parking** is provided for faculty, students, staff and community	5	*3*
Adequate parking is provided for faculty, staff, and community parking, and is located on asphalt pavement in poor condition.		
TOTAL - 1.0 The School Site	100	*72*

Bottom of page

Suitability Appraisal of **2.0 Structural and Mechanical Features** for Elizabeth_Price_ES_June_2009_Jan_2015_EEA_June_2018_Desktop_Update

2.0 Structural and Mechanical Features	Points Allocated	Points
Structural		
2.1 Structure meets all **barrier-free** requirements both externally and internally	15	*9*
Entire building is not ADA-compliant.		
2.2 **Roofs** appear sound, have positive drainage, and are weather tight	15	*8*
The roofs over the entire building require replacement.		
2.3 **Foundations** are strong and stable with no observable cracks	10	*8*
Foundations are in good condition with no observable cracks.		
2.4 **Exterior and interior walls** have sufficient expansion joints and are free of deterioration	10	*6*
Exterior and interior walls are in fair condition. Some masonry repair work is required and all masonry surfaces require cleaning and sealing. Additional control joints are required.		
2.5 **Entrances and exits** are located so as to permit efficient student traffic flow	10	*8*
Exits are properly located to allow safe egress from the building.		
2.6 **Building ''envelope''** generally provides for energy conservation (see criteria)	10	*6*
Building envelope meets minimum energy conservation requirements.		
2.7 Structure is **free of friable asbestos** and **toxic materials**	10	*4*
The building is assumed to contain asbestos and other hazardous materials.		
2.8 Interior walls permit sufficient **flexibility** for a variety of class sizes	10	*6*
Interior walls throughout the facility are fixed walls and are not flexible.		
Mechanical/Electrical	Points Allocated	Points
2.9 **Adequate light sources** are well maintained, and properly placed and are not subject to overheating	15	*4*
Light sources are improperly placed and provide inadequate lighting in some areas. Fixtures are poorly maintained in some areas. Light fixtures do not appear to be subject to overheating.		
2.10 **Internal water supply** is adequate with sufficient pressure to meet health and safety requirements	15	*6*
Internal water supply will not support a future fire suppression system, but appears to be adequate for current requirements.		
2.11 Each teaching/learning area has adequate convenient **wall outlets**, phone and computer cabling for technology applications	15	*4*
Classrooms have an inadequate number of outlets and data jacks for technology applications.		
2.12 **Electrical controls** are safely protected with **disconnect switches** easily accessible	10	*2*
Disconnect switches are not adequately provided to allow for safe servicing of equipment.		
2.13 **Drinking fountains** are adequate in number and placement, and are properly maintained including provisions for the disabled	10	*2*
Drinking fountains are not adequate in number and placement, and do not meet ADA requirements. Drinking fountains do not appear to be properly maintained.		
2.14 Number and size of **restrooms meet requirements**	10	*8*
The number and size of Restrooms meet requirements.		
2.15 **Drainage systems** are properly maintained and meet requirements	10	*2*

Drainage systems for the overall facility, consisting of sanitary waste piping, are cast iron, are original to each addition, exhibit some signs of leaking and are in fair condition.

2.16 **Fire alarms, smoke detectors, and sprinkler systems** are properly maintained and meet requirements	10	*4*

The fire alarm system does not meet requirements. Smoke detectors are not adequately provided. The facility is not sprinkled.

2.17 **Intercommunication system** consists of a central unit that allows dependable **two-way communication** between the office and instructional areas	10	*4*

The central intercommunication system provides unreliable two-way communication between the Administration area and all teaching areas, can only be initiated by the Main Office, and is outdated. Equipment such as speakers, are in fair condition. Telephone system is used as an alternate method of communication with the office.

2.18 **Exterior water supply** is sufficient and available for normal usage	5	*4*

Exterior wall hydrants are adequately provided around the exterior of the facility.

TOTAL - 2.0 Structural and Mechanical Features	200	*95*

Bottom of page

Suitability Appraisal of **3.0 Plant Maintainability** for Elizabeth_Price_ES_June_2009_Jan_2015_EEA_June_2018_Desktop_Update

3.0 Plant Maintainability	Points Allocated	Points
3.1 **Windows, doors, and walls** are of material and finish requiring minimum maintenance	15	*12*
Exterior materials and finishes for doors, windows and walls are durable and require minimal maintenance.		
3.2 **Floor surfaces** throughout the building require minimum care	15	*12*
Flooring throughout the facility consists of VCT, VAT, carpet, and terrazzo, which is well maintained throughout the facility.		
3.3 **Ceilings and walls** throughout the building, including service areas, are easily cleaned and resistant to stain	10	*6*
Acoustical tile ceilings are not easily cleaned or resistant to stain. Glazed and painted block is easily cleaned and resistant to stain.		
3.4 **Built-in equipment** is designed and constructed for ease of maintenance	10	*4*
Casework is wood type construction that is original to the building, and is in poor condition.		
3.5 **Finishes and hardware**, with compatible keying system, are of durable quality	10	*6*
Door hardware varies throughout the facility, does not meet ADA requirements, and keying systems are worn.		
3.6 **Restroom fixtures** are wall mounted and of quality finish	10	*4*
Fixtures are floor and wall mounted and are of fair to poor quality.		
3.7 Adequate **custodial storage space** with water and drain is accessible throughout the building	10	*8*
Custodial storage space is adequately located throughout the facility, including provisions for water and drains.		
3.8 Adequate **electrical outlets and power**, to permit routine cleaning, are available in every area	10	*2*
Electrical outlets are inadequately provided in Corridors and do not allow for convenient routine cleaning.		
3.9 **Outdoor light fixtures, electrical outlets**, equipment, and other fixtures are accessible for repair and replacement	10	*4*
Outdoor light fixtures are inadequately provided, but are accessible for repair and replacement. Electrical outlets are inadequately provided around the exterior of the facility.		
TOTAL - 3.0 Plant Maintainability	100	*58*

Bottom of page

Suitability Appraisal of **4.0 Building Safety and Security** for Elizabeth_Price_ES_June_2009_Jan_2015_EEA_June_2018_Desktop_Update

4.0 Building Safety and Security	Points Allocated	Points
Site Safety		
4.1 **Student loading areas** are segregated from other vehicular traffic and pedestrian walkways	15	*9*
Student loading is not separated from other vehicular traffic.		
4.2 **Walkways**, both on and offsite, are available for safety of pedestrians	10	*8*
Walkways are adequately provided both on and off-site for pedestrian safety.		
4.3 **Access streets** have sufficient signals and signs to permit safe entrance to and exit from school area	5	*4*
School signs and signals are located as required on adjacent access streets.		
4.4 **Vehicular entrances and exits** permit safe traffic flow	5	*2*
Buses and other vehicular traffic use the same entrance and exit points to the site, which does not provide safe vehicular traffic flow.		
4.5 ES **Playground equipment** is free from hazard MS Location and types of **intramural equipment** are free from hazard HS **Athletic field equipment** is properly located and is free from hazard	5	*3*
Playground equipment consists of plastic coated steel and high density plastic type equipment in good yto fair condition, appears to be free from hazard, and is located on an approved soft surface material to a insufficient depth.		

Building Safety	Points Allocated	Points
4.6 **The heating unit(s)** is located away from student occupied areas	20	*10*
Heating boilers are located in rooms that are not accessible by students. Unit ventilators and fin tubes are located in the Classrooms and other learning areas.		
4.7 Multi-story buildings have at least **two stairways** for student egress	15	*15*
The overall facility is one story without stairways.		
4.8 **Exterior doors** open outward and are equipped with panic hardware	10	*10*
Exterior doors open in the direction of travel and are equipped with panic hardware.		
4.9 **Emergency lighting** is provided throughout the entire building with exit signs on separate electrical circuits	10	*2*
Exit signs are not on separate circuits and are inadequately provided. The facility is inadequately equipped with emergency egress light fixtures. The facility is not equipped with an emergency generator.		
4.10 **Classroom doors** are recessed and open outward	10	*6*
Classroom doors are semi-recessed from the Corridor and open outward without proper ADA clearances, but do not impede traffic flow in the Corridors.		
4.11 **Building security systems** are provided to assure uninterrupted operation of the educational program	10	*2*
Security systems are inadequately provided and are in fair condition.		
4.12 **Flooring** (including ramps and stairways) is maintained in a non-slip condition	5	*4*
VCT, Terrazzo, Carpet, and VAT flooring have been well maintained throughout the facility.		
4.13 **Stair risers** (interior and exterior) do not exceed 6 1/2 inches and range in number from 3 - 16	5	*4*
The overall facility is one story without stairways. Stair treads and risers at the steps of the Stage are properly designed and meet requirements.		
4.14 **Glass** is properly located and protected with wire or safety material to prevent accidental student injury	5	*2*
Glass at door vision panels are not tempered or provided with a wire mesh for safety.		
4.15 **Fixed Projections** in the traffic areas do not extend more than eight inches from the corridor wall	5	*3*

Drinking fountains and electric water coolers have not been recessed and extend more than eight inches from the Corridor wall, which impede traffic flow in the Corridors.

4.16 **Traffic areas** terminate at an exit or a stairway leading to an egress	5	*5*
Exits are properly located to allow safe egress from the building.		

Emergency Safety	Points Allocated	Points
4.17 Adequate **fire safety equipment** is properly located	15	*2*
The facility is not sprinkled. Fire alarm devices are not provided adequately. Fire extinguishers are inadequately provided.		
4.18 There are at least **two independent exits** from any point in the building	15	*8*
There are no dead-end Corridors in the building.		
4.19 **Fire-resistant materials** are used throughout the structure	15	*12*
The structure is a masonry load bearing system. Interior walls are masonry.		
4.20 Automatic and manual **emergency alarm system** with a distinctive sound and flashing light is provided	15	*2*
The fire alarm is equipped with automatic actuation devices but is not adequately provided with visual indicating devices.		
TOTAL - 4.0 Building Safety and Security	200	*113*

Bottom of page

Suitability Appraisal of **5.0 Educational Adequacy** for Elizabeth_Price_ES_June_2009_Jan_2015_EEA_June_2018_Desktop_Update

5.0 Educational Adequacy	Points Allocated	Points
Academic Learning Space		
5.1 **Size of academic learning areas** meets desirable standards	25	*15*
The average Classroom in the 1953 Original Construction is 737 SF compared to 900 SF required by the OSDM. The average Classroom in the 1963 Addition is 756 SF compared to 900 SF required by the OSDM.		
5.2 **Classroom space** permits arrangements for small group activity	15	*9*
Undersized Classrooms do not allow sufficient space for effective small group activities.		
5.3 **Location of academic learning areas** is near related educational activities and away from disruptive noise	10	*6*
The Gymnasium is properly isolated from the academic learning areas to reduce distractions. The Music Room is located adjacent to academic learning areas, which can be distracting.		
5.4 **Personal space** in the classroom away from group instruction allows privacy time for individual students	10	*4*
Undersized Classrooms do not permit privacy time for individual students.		
5.5 **Storage for student materials** is adequate	10	*8*
Lockers, located in the Corridor, are adequately provided for student storage. Storage cubbies, located in the Classroom, are adequately provided for student storage.		
5.6 **Storage for teacher materials** is adequate	10	*4*
Casework is inadequately provided for storage of teacher materials.		
Special Learning Space	Points Allocated	Points
5.7 **Size of special learning area(s)** meets standards	15	*9*
The Special Education Classroom is 737 SF compared to 900 SF recommended in the OSDM. Special Education Classrooms are undersized compared to standards.		
5.8 **Design of specialized learning area(s)** is compatible with instructional need	10	*4*
Special Education spaces are not adequately provided to meet instructional needs.		
5.9 **Library/Resource/Media Center** provides appropriate and attractive space	10	*4*
The Media Center is 735 SF compared to 1,351 SF recommended in the OSDM. The Library is not visually appealing and does not provide natural light.		
5.10 **Gymnasium (or covered P.E. area)** adequately serves physical education instruction	5	*4*
The Gymnasium is 4,600 SF compared to 3,500-5,000 SF recommended in the OSDM.		
5.11 ES **Pre-kindergarten and kindergarten space** is appropriate for age of students and nature of instruction MS/HS **Science** program is provided sufficient space and equipment	10	*6*
Kindergarten spaces are undersized, and do not provide adequate instruction space.		
5.12 **Music Program** is provided adequate sound treated space	5	*2*
The Music Room is 737 SF compared to 1,800-3,000 recommended in the OSDM. Music instruction is provided in a standard Classroom without any sound treatment.		
5.13 **Space for art** is appropriate for special instruction, supplies, and equipment	5	*2*
The Art Room is 756 SF compared to 1,200 SF recommended in the OSDM. The Art Room is undersized and does not provide sufficient space for storage of supplies and equipment.		
School Facility Appraisal	Points Allocated	Points
5.14 **Space for technology education** permits use of state-of-the-art equipment	5	*0*

The facility is not provided with Computer Labs for student use.

5.15 Space for **small groups and remedial instruction** is provided adjacent to classrooms	5	*2*

No spaces have been provided adjacent to Classrooms for small groups or remedial instruction.

5.16 **Storage for student and teacher material** is adequate	5	*3*

Lockers and storage cubbies have been adequately provided for storage of student materials. Casework is not adequately provided for storage of teacher materials.

Support Space	Points Allocated	Points
5.17 **Teacher's lounge and work areas** reflect teachers as professionals	10	*6*

The Teacher's Lounge is 334 SF compared to 450-900 SF, for 8-24 staff, recommended in the OSDM.

5.18 **Cafeteria/Kitchen** is attractive with sufficient space for seating/dining, delivery, storage, and food preparation	10	*6*

The Kitchen space is 780 SF compared to 1,351 SF recommended in the OSDM. Student Dining shares the Gymnasium space.

5.19 **Administrative offices** provided are consistent in appearance and function with the maturity of the students served	5	*2*

Administrative Offices are not adequately provided for Elementary School students.

5.20 **Counselor's office** insures privacy and sufficient storage	5	*2*

The Counselor's Office is 121 SF compared to 120 SF, plus 100 SF for Storage and 200 SF for Conference, recommended in the OSDM.

5.21 **Clinic** is near administrative offices and is equipped to meet requirements	5	*2*

The Clinic is 200 SF compared to 370 SF recommended in the OSDM.

5.22 **Suitable reception space** is available for students, teachers, and visitors	5	*2*

Reception space consists of approximately 167 SF compared to 200-400 SF recommended by the OSDM.

5.23 **Administrative personnel** are provided **sufficient work space and privacy**	5	*1*

The Administrative area consists of approximately 661 SF for the principal, assistant principal, secretary, Conference Room, Storage, Copy Room, and Restroom, compared to 2,600 SF recommended by the OSDM.

TOTAL - 5.0 Educational Adequacy	200	*103*

Bottom of page

Suitability Appraisal of **6.0 Environment for Education** for Elizabeth_Price_ES_June_2009_Jan_2015_EEA_June_2018_Desktop_Update

6.0 Environment for Education	Points Allocated	Points
Exterior Environment		
6.1 Overall **design is aesthetically pleasing** to age of students	15	*12*
The building is a conventional design with standard detailing, which is aesthetically acceptable.		
6.2 Site and building are **well landscaped**	10	*8*
The site is moderately landscaped with mature shade trees, ornamental trees, and shrubs which define the property and emphasize the building entrance. Lawn areas where mowing is required do not exceed 3:1 slope.		
6.3 **Exterior noise and poor environment** do not disrupt learning	10	*8*
The site is adjacent to residential uses, and there are no undesirable features adjacent to the school site.		
6.4 **Entrances and walkways** are **sheltered** from sun and inclement weather	10	*8*
The main entrance to the School is partially sheltered.		
6.5 **Building materials** provide attractive color and texture	5	*4*
Exterior building materials consist of brick and stone, which provide an attractive color and texture.		
Interior Environment	Points Allocated	Points
6.6 **Color schemes, building materials, and decor** provide an impetus to learning	20	*16*
The color palette is comprised of neutral hues with accent color of more saturated hues. School colors are reflected in the athletic areas. The use of repeated colors and materials give the building some unity and a sense of consistency, which enhances the learning environment.		
6.7 **Year around comfortable temperature and humidity** are provided throughout the building	15	*2*
The facility is not air conditioned to provide year-round temperature and humidity control.		
6.8 **Ventilating system** provides adequate quiet circulation of clean air and meets 15cfm VBC requirement	15	*6*
The ventilating systems do not provide an adequate quantity of ventilation air to the spaces. Ventilation systems introduce minimal noise into the teaching and learning areas.		
6.9 **Lighting system** provides proper intensity, diffusion, and distribution of illumination	15	*4*
The lighting system does not provide proper intensity in some areas. Location of lighting fixtures provides uneven distribution of illumination. Diffusion of illumination is adequately provided by the light fixture lenses in some areas.		
6.10 **Drinking fountains and restroom facilities** are conveniently located	15	*12*
Drinking fountains and Restroom facilities are conveniently located.		
6.11 **Communication among students** is enhanced by commons area(s) for socialization	10	*8*
There are areas for students to gather in the Multi-Purpose Room, as well as a gathering area in the Entry Corridor.		
6.12 **Traffic flow** is aided by appropriate foyers and corridors	10	*8*
Corridors and Foyers are adequately designed for efficient traffic flow.		
6.13 **Areas for students to interact** are suitable to the age group	10	*8*
There are areas for students to gather in the Multi-Purpose Room, as well as a gathering area in the Entry Corridor.		
6.14 **Large group areas are designed** for effective management of students	10	*8*
The Multipurpose space is adequately designed to manage large groups of students.		
6.15 **Acoustical treatment** of ceilings, walls, and floors provides effective sound control	10	*4*

Limited consideration has been given to acoustical treatment of Classrooms and Corridors.

6.16 **Window design** contributes to a pleasant environment	10	*8*
The windows are well designed and contribute to a pleasant environment.		
6.17 **Furniture and equipment** provide a pleasing atmosphere	10	*3*
Classroom furniture is mismatched and in fair to poor condition.		
TOTAL - 6.0 Environment for Education	200	*127*

LEED Observation Notes

School District:	Cuyahoga Falls City
County:	Summit
School District IRN:	43836
Building:	Elizabeth Price Elementary
Building IRN:	10215

Sustainable Sites

Construction process can have a harmful effect on local ecology, especially when buildings are build on productive agricultural, wildlife or open areas. Several measures can be take however to prevent the impact on undeveloped lands or to improve previously contaminated sites. Appropriate location reduces the need for private transportation and helps to prevent an increase in air pollution. Developing buildings in urban areas and on brownfield sites instead of greenfield locations has economical and environmental benefits. Controlling stormwater runoff and erosion can prevent the worsening of water quality in receiving bodies of water and the impact on aquatic life. Once the building is constructed, it's important to decrease heat island effects and reduce the light pollution on the site.

(source: LEED Reference Guide, 2001:9)

Water Efficiency

In the US ca. 340 billion gallons of fresh water are withdrawn daily from surface sources, 65% of which is discharged later after use. Water is also withdrawn from underground aquifers The excessive usage of water results in the current water deficit, estimated at 3,700 billion gallons. Water efficiency measures in commercial buildings can reduce water usage by at least 30%. Low-flow fixtures, sensors or using non potable water for landscape irrigation, toilet flushing and building systems are just some of available strategies. Not only do they result in environmental savings, but also bring about financial benefits, related to lower water use fees, lower sewage volumes to treat and energy use reductions.

(source: LEED Reference Guide, 2001:65)

Energy & Atmosphere

Buildings in the US account for more than 30% of the total energy use and for approximately 60% of electricity. 75% of energy is derived from the burning of fossil fuels, which releases CO2 into the Atmosphere and contributes to global warming. Moreover, coal fired electric utilities release nitrogen oxides and sulfur dioxide, where the former contribute to smog and the latter to acid rain. Other types of energy production are not less harmful. Burning of natural gas produces nitrogen oxides and greenhouse gases as well, nuclear power creates nuclear wastes, while hydroelectric generating plants disrupt natural water flows. Luckily there are several practices that can reduce energy consumption and are environmentally and economically beneficial. Not only will they reduce the air pollution and mitigate global warming thanks to being less dependent on power plants, but also they will reduce operational costs and will quickly pay back. In order to make the most of those practices, it's important to adopt a holistic approach to the building's energy load and integrate different energy saving strategies.

(source: LEED Reference Guide, 2001:93)

Material & Resources

The steps related to process building materials, such as extraction, processing and transportation are not environmentally natural, as they pollute the air, water and use natural resources. Construction and demolition wastes account for 40% of the solid waste stream in the US. Reusing existing documents is one of the best strategies to reduce solid wastes volumes and prevents then from ending up at landfills. It also reduces habitat disturbance and minimizes the need for the surrounding infrastructure. While using new materials one should take into account different material sources. Salvaged materials provide savings on material costs, recycled content material minimizes waste products and local materials reduce the environmental impact of transportation. Finally, using rapidly renewable materials and certified wood decreases the consumption of natural resources. Recycling and reusing construction waste is another strategy to be taken into consideration in sustainable design.

(source: LEED Reference Guide, 2001:167)

Indoor Environmental Quality

As we spend a big majority of our time indoors, the emphasis should be put on optimal indoor environmental quality strategies while (re)designing a building . Otherwise, a poor IEQ will have adverse effects on occupants' health, productivity and quality of life. IEQ strategies such as ventilation effectiveness and control of contaminants or a building flush-out prior to occupancy can reduce potential liability, increase the market value of the building but can also result in a significantly higher productivity (16%). Other strategies involve automatic sensors and controls, introducing fresh air to the building or providing lots of daylighting views.

(source: LEED Reference Guide, 2001:215)

Innovation & Design Process

This category is aimed at recognizing projects that implemented innovative building features and sustainable building knowledge, and whose strategy or measure results exceeded those which are required by the LEED Rating System. Expertise in sustainable design is the key element of the innovative design and construction process.

(source: LEED Reference Guide, 2001:271)

Justification for Allocation of Points

Building Name and Level: **Elizabeth Price Elementary**

K-5

Building features that clearly exceed criteria:

1.
2.
3.
4.
5.
6.

Building features that are non-existent or very inadequate:

1. The building does not meet ADA requirements.
2. The building does not contain a fire suppression system.
3. The building is reported to contain asbestos and other hazardous materials.
4. The Classrooms are undersized.
5. The Art Room and Music Room are undersized and lack storage space.
6.

Back to Assessment Summary

Environmental Hazards Assessment Cost Estimates

Owner:	Cuyahoga Falls City
Facility:	Elizabeth Price Elementary
Date of Initial Assessment:	Jan 6, 2015
Date of Assessment Update:	Jul 6, 2018
Cost Set:	2018

District IRN:	43836
Building IRN:	10215
Firm:	Hammond Construction

Scope remains unchanged after cost updates.

Building Addition	Addition Area (sf)	Total of Environmental Hazards Assessment Cost Estimates	
		Renovation	Demolition
1953 Original Construction	32,418	$106,491.80	$93,491.80
1963 Classroom Addition	4,167	$21,716.70	$21,716.70
Total	36,585	$128,208.50	$115,208.50
Total with Regional Cost Factor (103.60%)	—	$132,824.01	$119,356.01
Regional Total with Soft Costs & Contingency	—	$165,273.31	$148,515.04

Environmental Hazards(Enhanced) - Cuyahoga Falls City (43836) - Elizabeth Price Elementary (10215) - Original Construction

Owner:	Cuyahoga Falls City	**Bldg. IRN:**	10215
Facility:	Elizabeth Price Elementary	**BuildingAdd:**	Original Construction
Date On-Site:	2015-01-06	**Consultant Name:**	Gandee & Associates, Inc.

A. Asbestos Containing Material (ACM) — AFM=Asbestos Free Material

	ACM Found	Status	Quantity	Unit Cost	Estimated Cost
1.	Boiler/Furnace Insulation Removal	Not Present	0	$10.00	$0.00
2.	Breeching Insulation Removal	Assumed Asbestos-Containing Material	75	$10.00	$750.00
3.	Tank Insulation Removal	Not Present	0	$8.00	$0.00
4.	Duct Insulation Removal	Not Present	0	$8.00	$0.00
5.	Pipe Insulation Removal	Assumed Asbestos-Containing Material	700	$10.00	$7,000.00
6.	Pipe Fitting Insulation Removal	Assumed Asbestos-Containing Material	50	$20.00	$1,000.00
7.	Pipe Insulation Removal (Crawlspace/Tunnel)	Not Present	0	$12.00	$0.00
8.	Pipe Fitting Insulation Removal (Crawlspace/Tunnel)	Not Present	0	$30.00	$0.00
9.	Pipe Insulation Removal (Hidden in Walls/Ceilings)	Assumed Asbestos-Containing Material	650	$15.00	$9,750.00
10.	Dismantling of Boiler/Furnace/Incinerator	Assumed Asbestos-Containing Material	2	$2,000.00	$4,000.00
11.	Flexible Duct Connection Removal	Not Present	0	$100.00	$0.00
12.	Acoustical Plaster Removal	Not Present	0	$7.00	$0.00
13.	Fireproofing Removal	Not Present	0	$25.00	$0.00
14.	Hard Plaster Removal	Reported / Assumed Asbestos-Free Material	0	$7.00	$0.00
15.	Gypsum Board Removal	Not Present	0	$6.00	$0.00
16.	Acoustical Panel/Tile Ceiling Removal	Reported / Assumed Asbestos-Free Material	0	$3.00	$0.00
17.	Laboratory Table/Counter Top Removal	Not Present	0	$100.00	$0.00
18.	Cement Board Removal	Not Present	0	$5.00	$0.00
19.	Electric Cord Insulation Removal	Not Present	0	$1.00	$0.00
20.	Light (Reflector) Fixture Removal	Not Present	0	$50.00	$0.00
21.	Sheet Flooring with Friable Backer Removal	Not Present	0	$4.00	$0.00
22.	Fire Door Removal	Assumed Asbestos-Containing Material	2	$100.00	$200.00
23.	Door and Window Panel Removal	Not Present	0	$100.00	$0.00
24.	Decontamination of Crawlspace/Chase/Tunnel	Not Present	0	$3.00	$0.00
25.	Soil Removal	Not Present	0	$150.00	$0.00
26.	Non-ACM Ceiling/Wall Removal (for access)	Assumed Asbestos-Containing Material	3600	$2.00	$7,200.00
27.	Window Component (Compound, Tape, or Caulk) - Reno & Demo	Reported / Assumed Asbestos-Free Material	0	$300.00	$0.00
28.	Window Component (Compound, Tape, or Caulk) - Reno Only	Reported / Assumed Asbestos-Free Material	0	$300.00	$0.00
29.	Resilient Flooring Removal, Including Mastic	Reported Asbestos-Containing Material	20000	$3.00	$60,000.00
30.	Carpet Mastic Removal	Not Present	0	$2.00	$0.00
31.	Carpet Removal (over RFC)	Assumed Asbestos-Containing Material	350	$1.00	$350.00
32.	Acoustical Tile Mastic Removal	Reported / Assumed Asbestos-Free Material	0	$3.00	$0.00
33.	Sink Undercoating Removal	Not Present	0	$100.00	$0.00
34.	Roofing Removal	Reported / Assumed Asbestos-Free Material	0	$2.00	$0.00
35.	(Sum of Lines 1-34)	**Total Asb. Hazard Abatement Cost for Renovation Work**			$90,250.00
36.	(Sum of Lines 1-34)	**Total Asb. Hazard Abatement Cost for Demolition Work**			$90,250.00

B. Removal Of Underground Storage Tanks — ☑ None Reported

	Tank No.	Location	Age	Product Stored	Size	Est.Rem.Cost
1.	(Sum of Lines 1-0)			**Total Cost For Removal Of Underground Storage Tanks**		$0.00

C. Lead-Based Paint (LBP) - Renovation Only — ☐ Addition Constructed after 1980

1.	Estimated Cost For Abatement Contractor to Perform Lead Mock-Ups		$5,000.00
2.	Special Engineering Fees for LBP Mock-Ups		$5,000.00
3.	(Sum of Lines 1-2)	**Total Cost for Lead-Based Paint Mock-Ups**	$10,000.00

D. Fluorescent Lamps & Ballasts Recycling/Incineration — ☐ Not Applicable

	Area Of Building Addition	Square Feet w/Fluorescent Lamps & Ballasts	Unit Cost	Total Cost
1.	32418	32418	$0.10	$3,241.80

E. Other Environmental Hazards/Remarks — ☐ None Reported

	Description		Cost Estimate
1.	See Bulk Sample Record Nos. 1 through 6, & 8 for sampling results in this addition.		$0.00
2.	XRF testing for lead-based paint is recommended for compliance with EPA's RRP Program.		$3,000.00
3.	(Sum of Lines 1-2)	**Total Cost for Other Environmental Hazards - Renovation**	$3,000.00
4.	(Sum of Lines 1-2)	**Total Cost for Other Environmental Hazards - Demolition**	$0.00

F. Environmental Hazards Assessment Cost Estimate Summaries

1.	A35, B1, C3, D1, and E3	**Total Cost for Env. Hazards Work - Renovation**	$106,491.80
2.	A36, B1, D1, and E4	**Total Cost for Env. Hazards Work - Demolition**	$93,491.80

* INSPECTION ASSUMPTIONS for Reported/Assumed Asbestos-Free Materials (Rep/Asm AFM):

a. Unless reported otherwise by the District, materials installed after 1980 are assumed to be asbestos-free.

b. Unless reported otherwise by the District, small quantities (less than 1,000 square feet) of the following materials are assumed to be asbestos free: hard plaster, acoustical plaster and gypsum board systems; acoustical panels and tiles; fireproofing; 12"×12" floor tile and mastic.

c. Unless reported otherwise by the District, all roofing materials are assumed to be asbestos-free.

THESE MATERIALS SHOULD BE PROPERLY SAMPLED AND ANALYZED FOR ASBESTOS PRIOR TO DISTURBING THEM.

Environmental Hazards(Enhanced) - Cuyahoga Falls City (43836) - Elizabeth Price Elementary (10215) - Classroom Addition

Owner:	Cuyahoga Falls City	**Bldg. IRN:**	10215
Facility:	Elizabeth Price Elementary	**BuildingAdd:**	Classroom Addition
Date On-Site:	2015-01-06	**Consultant Name:**	Gandee & Associates, Inc.

A. Asbestos Containing Material (ACM) — AFM=Asbestos Free Material

	ACM Found	Status	Quantity	Unit Cost	Estimated Cost
1.	Boiler/Furnace Insulation Removal	Not Present	0	$10.00	$0.00
2.	Breeching Insulation Removal	Not Present	0	$10.00	$0.00
3.	Tank Insulation Removal	Not Present	0	$8.00	$0.00
4.	Duct Insulation Removal	Not Present	0	$8.00	$0.00
5.	Pipe Insulation Removal	Not Present	0	$10.00	$0.00
6.	Pipe Fitting Insulation Removal	Not Present	0	$20.00	$0.00
7.	Pipe Insulation Removal (Crawlspace/Tunnel)	Not Present	0	$12.00	$0.00
8.	Pipe Fitting Insulation Removal (Crawlspace/Tunnel)	Not Present	0	$30.00	$0.00
9.	Pipe Insulation Removal (Hidden in Walls/Ceilings)	Assumed Asbestos-Containing Material	100	$15.00	$1,500.00
10.	Dismantling of Boiler/Furnace/Incinerator	Not Present	0	$2,000.00	$0.00
11.	Flexible Duct Connection Removal	Not Present	0	$100.00	$0.00
12.	Acoustical Plaster Removal	Not Present	0	$7.00	$0.00
13.	Fireproofing Removal	Not Present	0	$25.00	$0.00
14.	Hard Plaster Removal	Not Present	0	$7.00	$0.00
15.	Gypsum Board Removal	Reported / Assumed Asbestos-Free Material	0	$6.00	$0.00
16.	Acoustical Panel/Tile Ceiling Removal	Not Present	0	$3.00	$0.00
17.	Laboratory Table/Counter Top Removal	Not Present	0	$100.00	$0.00
18.	Cement Board Removal	Not Present	0	$5.00	$0.00
19.	Electric Cord Insulation Removal	Not Present	0	$1.00	$0.00
20.	Light (Reflector) Fixture Removal	Not Present	0	$50.00	$0.00
21.	Sheet Flooring with Friable Backer Removal	Not Present	0	$4.00	$0.00
22.	Fire Door Removal	Not Present	0	$100.00	$0.00
23.	Door and Window Panel Removal	Not Present	0	$100.00	$0.00
24.	Decontamination of Crawlspace/Chase/Tunnel	Not Present	0	$3.00	$0.00
25.	Soil Removal	Not Present	0	$150.00	$0.00
26.	Non-ACM Ceiling/Wall Removal (for access)	Assumed Asbestos-Containing Material	400	$2.00	$800.00
27.	Window Component (Compound, Tape, or Caulk) - Reno & Demo	Reported / Assumed Asbestos-Free Material	0	$300.00	$0.00
28.	Window Component (Compound, Tape, or Caulk) - Reno Only	Reported / Assumed Asbestos-Free Material	0	$300.00	$0.00
29.	Resilient Flooring Removal, Including Mastic	Reported Asbestos-Containing Material	3100	$3.00	$9,300.00
30.	Carpet Mastic Removal	Not Present	0	$2.00	$0.00
31.	Carpet Removal (over RFC)	Not Present	0	$1.00	$0.00
32.	Acoustical Tile Mastic Removal	Assumed Asbestos-Containing Material	3100	$3.00	$9,300.00
33.	Sink Undercoating Removal	Assumed Asbestos-Containing Material	4	$100.00	$400.00
34.	Roofing Removal	Reported / Assumed Asbestos-Free Material	0	$2.00	$0.00
35.	(Sum of Lines 1-34)	**Total Asb. Hazard Abatement Cost for Renovation Work**			$21,300.00
36.	(Sum of Lines 1-34)	**Total Asb. Hazard Abatement Cost for Demolition Work**			$21,300.00

B. Removal Of Underground Storage Tanks — ☑ None Reported

	Tank No.	Location	Age	Product Stored	Size	Est.Rem.Cost
1.	(Sum of Lines 1-0)			**Total Cost For Removal Of Underground Storage Tanks**		$0.00

C. Lead-Based Paint (LBP) - Renovation Only — ☐ Addition Constructed after 1980

1.	Estimated Cost For Abatement Contractor to Perform Lead Mock-Ups		$0.00
2.	Special Engineering Fees for LBP Mock-Ups		$0.00
3.	(Sum of Lines 1-2)	**Total Cost for Lead-Based Paint Mock-Ups**	$0.00

D. Fluorescent Lamps & Ballasts Recycling/Incineration — ☐ Not Applicable

	Area Of Building Addition	Square Feet w/Fluorescent Lamps & Ballasts	Unit Cost	Total Cost
1.	4167	4167	$0.10	$416.70

E. Other Environmental Hazards/Remarks — ☐ None Reported

	Description		Cost Estimate
1.	Costs for lead-based paint mock-ups are included in assessment for 1953 (Original Construction).		$0.00
2.	See Bulk Sample Record Nos. 7 & 8 for sampling results in this addition.		$0.00
3.	(Sum of Lines 1-2)	**Total Cost for Other Environmental Hazards - Renovation**	$0.00
4.	(Sum of Lines 1-2)	**Total Cost for Other Environmental Hazards - Demolition**	$0.00

F. Environmental Hazards Assessment Cost Estimate Summaries

1.	A35, B1, C3, D1, and E3	**Total Cost for Env. Hazards Work - Renovation**	$21,716.70
2.	A36, B1, D1, and E4	**Total Cost for Env. Hazards Work - Demolition**	$21,716.70

* INSPECTION ASSUMPTIONS for Reported/Assumed Asbestos-Free Materials (Rep/Asm AFM):

a. Unless reported otherwise by the District, materials installed after 1980 are assumed to be asbestos-free.

b. Unless reported otherwise by the District, small quantities (less than 1,000 square feet) of the following materials are assumed to be asbestos free: hard plaster, acoustical plaster and gypsum board systems; acoustical panels and tiles; fireproofing; 12"×12" floor tile and mastic.

c. Unless reported otherwise by the District, all roofing materials are assumed to be asbestos-free.

THESE MATERIALS SHOULD BE PROPERLY SAMPLED AND ANALYZED FOR ASBESTOS PRIOR TO DISTURBING THEM.